



SI B54 01 19
Special Roofs

March 2019
Technical Service

WINDSHIELD COWL PANEL SEAL DEFORMED


MODEL

| | | | |
|-------------------|--|--|--|
| G29 (Z4 Roadster) | | | |
|-------------------|--|--|--|

Produced until 3/6/2019

SITUATION

The upper windshield cowl panel seal may appear deformed as shown below:

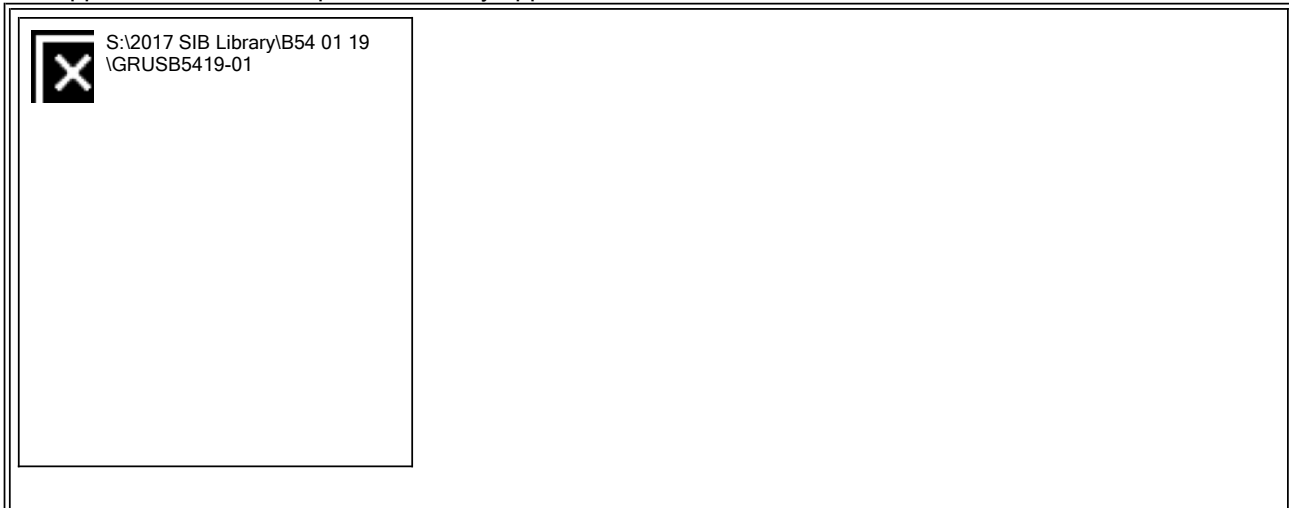

CAUSE

The seal was not fully seated during installation, allowing the convertible top to press the seal out away from the windshield when closed.

CORRECTION

Ensure the seal is completely seated.

PROCEDURE

1. Open the convertible top to allow access to the top of the windshield sealing area.
2. Press down firmly on the seal to ensure it presses completely into the windshield cowl panel. Verify the appearance is uniform across the entire length of the windshield.
3. Completely close the convertible top. It is suggested to leave the convertible top closed for 24 hours to ensure the seal correctly seats into the windshield cowl.

PARTS INFORMATION

No parts are required.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

| | | |
|-------------------------|-------------------------|--|
| Defect Code: | 5431054100 | Edge guard/cowl panel seal, roof frame (Convertible, Roadster) poorly adapted/fitted |
| | | |
| Labor Operation: | Labor Allowance: | Description: |
| 54 00 001 | 4 FRU | Work time to reposition the cowl panel seal (Main work) |
| Or: | | |
| 54 00 001 | 2 FRU | Work time to reposition the cowl panel seal (Plus work – Vehicle is already in the workshop) |

[Copyright ©2019 BMW of North America, Inc.]