



Countries: CANADA, UNITED STATES Document ID: IK0800581
Availability: ISIS, FleetSIS, Body Builder, IsSIR Revision: 0
Major System: ELECTRICAL SYSTEM Created: 3/21/2019
Current Language: English Last Modified: 4/1/2019
Other Languages: NONE Author: Charles Schroeder
Viewed: 60

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 2	Not Helpful 0
---------------	------------------------	---	----------------------	-----------	----------------------	------------------	----------------------

Title: DuraStar 08TSB BlindSpotter Wired to Battery Power

Applies To: DuraStar with 08TSB built between 11/23/2016 and 11/12/2018

CHANGE LOG

Please refer to the change log text box below for recent changes to this article:

04/01/2019 - Initial Article Release.

DESCRIPTION

Certain DuraStar vehicles with feature 0008TSB COLLISION WARNING SYSTEM {Bendix BlindSpotter} Side Object Detection System; Includes Right Side Antenna & Side Display were built with the BlindSpotter on battery power. This article will provide instruction to ensure the BlindSpotter in on ignition power.

This only applies to DuraStar vehicles with 08TSB built between 11/23/2016 and 11/12/2018.

SYMPTOMS

Diagnostic Trouble Codes & Dashboard Indicator Lights:

DTC/Light	Description
No Faults or Warning Lights	

Customer Observations or Concerns:

- Frequently drained batteries
- Slow engine crank due to low voltage

SPECIAL TOOLS / SOFTWARE

Tool Description	Tool Number	Comments	Instructions
Not Applicable			

SERVICE PARTS INFORMATION

Kit Description	Part Number	Quantity Required	Notes
FUSE 10 AMP	MIN10	1	

DIAGNOSTIC STEPS

Step	Action	Decision
#1	DIAGNOSTIC: Remove the fuse panel cover. Inspect for wire 67TA in location F3-B.	Yes: Continue to Repair Steps


Is wire 67TA present in F3-B?

No: Check to see if BlindSpotter power wire 67TA has already been moved to F5-D or F5-E

NOTE:

Vehicles repaired prior to this iKNow articles release may have had the wire moved to F5-D

REPAIR STEPS

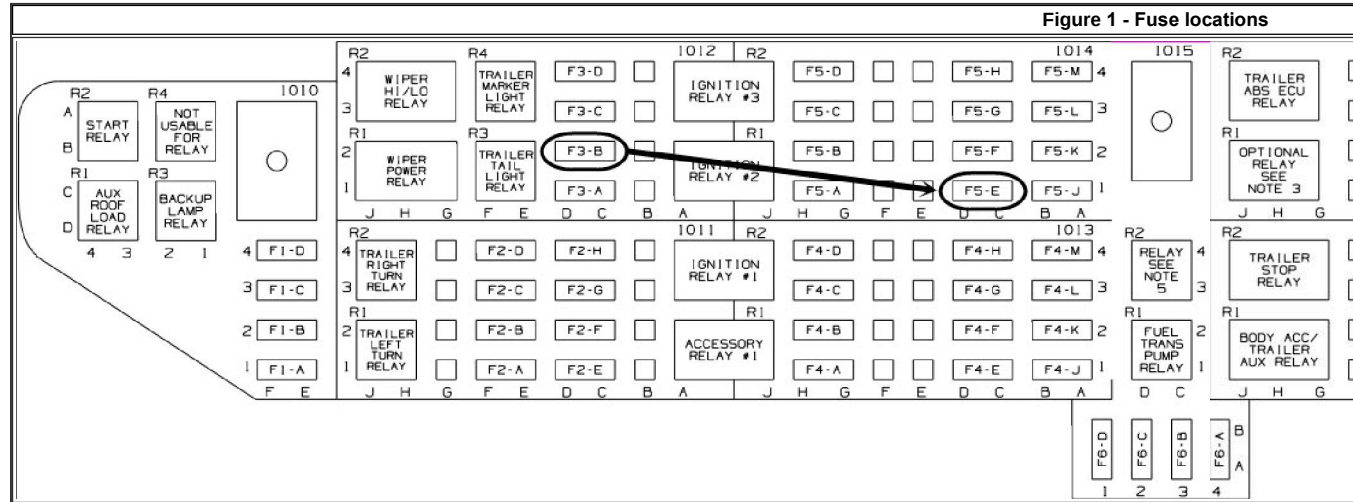

Wire 67TA will need to be moved from F3-B to F5-E

Figure 2 - Retainer removal example



1. Use a tool, such as a pocket screwdriver, to remove the terminal retainer in order to remove the terminal at F3-B.
2. You will need to remove the retainer in order to install the terminal at F5-E.
3. Re-install the retainers before you install any fuses.

WARRANTY INFORMATION

Warranty Claim Coding:

Refer to the [Warranty Coding Manual](#) for Group and Noun Codes.

Standard Repair Time(s):

Refer to the [SRT Manual](#) for Repair Times

OTHER RESOURCES

[Master Service Information Site](#)

Hide Details	Feedback Information
No Feedback Found	Viewed: 59
	Helpful: 2
	Not Helpful: 0

Copyright © 2019 Navistar, Inc.