

# Service Bulletin

19-049

## April 26, 2019

Version 1

## Apple CarPlay<sup>™</sup> Will Not Launch

## AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2019	HR-V	Sport, EX, EX-L, and Touring	3CZRU5H1XKG700001 thru 3CZRU5H14KM705481
			3CZRU6H99KM700076 thru 3CZRU6H9XKM707778
			3CZRU5H1XKM700432 thru 3CZRU6H19KM706423
			3CZRU5H78KM700188 thru 3CZRU5H79KM705271

#### SYMPTOM

iPhones cannot connect to Apple CarPlay<sup>™</sup>.

#### **POSSIBLE CAUSE**

The audio unit will not launch Apple CarPlay<sup>™</sup> when an iPhone is connected to the USB port.

#### **CORRECTIVE ACTION**

Update the audio unit software.

### WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
0100A1	Update the audio unit software.	0.3 hr	03214	03217	A19049A	39171-T7A-A11

Skill Level: Repair Technician

**CUSTOMER INFORMATION:**The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

#### **REPAIR PROCEDURE**

#### NOTES

- Before updating the software, write down the customer's audio unit presets.
- Connect a fully charged battery to the vehicle, and leave it connected during the entire procedure to maintain steady voltage.
- Apply the parking brake to keep the headlights turned off during the update.
- 1. From your computer's desktop, open Honda Firmware Downloader. Refer to job aid: *Honda Firmware Downloader* for any additional information. Make sure the USB flash drive is empty and formatted to FAT 32.
- 2. Enter the VIN. This is important as the software can be different depending on the trim level. Enter the service bulletin number, then select the download icon when the correct software is found.

#### NOTE

The software download may take up to **10-15 minutes** depending on the size of the file and the quality of your internet connection.



- 3. Once the download is complete, return to the vehicle.
- 4. Verify the software version.
  - 4.1. From the home screen, press the Day/Night button, **MENU** icon, and VOL/Power/AUDIO knob in sequence and hold them for about **5 seconds**.



#### 4.2. Select Detail Information & Setting.



- 4.3. From the **Detail Information & Setting** screen, press and hold the **MENU** icon for **5 seconds** until the display transfers to the **Developer Diag** screen.
- 4.4. From the **Developer Diag** screen, select **Detail Version Info**. Then, confirm the current **TEGRA Build Version** and **SH Main Software Version**. Refer to the tables below for current and new versions.

Developer Diag	Retu	rn		
FAN Control	•			
PiPiPon Configration				
Detail Version Info				
Bitmap Display				
Steer Angle Adjustment Result				
Models With Navigation (DA+)		Models Witho	out Navigation (DA)	
Detail Version Info	Return	Detail Version Info		
TEGRA Android Version: 4.0.4		TEGRA Android Version:	4.0.4	



Software Details	Current Software Versions			
	Models with Navigation	Models without Navigation		
TEGRA Build Version	81.01A.00.B.1025	81.01A.00.B.1021		
Touch Version	T5AR04	T5AR04		

Return

5. Once the software update is downloaded onto the USB flash drive, insert it into the USB port.



6. A screen will automatically appear with the prompt **Would you like to update?**. Make sure each software version of **Tegra/Touch** in the **New** section are correct. Select **Yes** to update the software.

	Models With Navi (DA+)			Models Without Navi (DA	V
MAP AUDIC	) SOURCE 🔿	4:55			Return
	Would you like to upd			Would you like to upo	late?
	Current	New		Current	New
Tegra Touch	81.01A.00.B.1025 T5AR04	82.01C.00.B.1025 T5AR04	Tegra Touch	81.01A.00.B.1021 T5AR04	82.01C.00.B.1021 T5AR04
FDR	No	Yes	FDR	No	Yes

## NOTE

If the screen does not appear, the software may not have correctly downloaded onto the USB flash drive. Try to download the software again.

Software Details	New Software Versions			
	Models with Navigation	Models without Navigation		
TEGRA Build Version	82.01C.00.B.1025	82.01C.00.B.1021		
Touch Version	T5AR04	T5AR04		

## NOTE

In case the USB flash drive gets unplugged, a **USB memory device unplugged** message will appear. Select **OK** to clear the screen, and connect the USB flash drive once again to continue the software update.

7. After selecting **Yes**, the unit will reboot and the version update will start. The screen below will display for about **30 minutes**.



8. Once the update is complete, the unit will reboot again. Remove the USB drive tool from the port.



9. After the update is complete, the following screen will appear. To bypass this screen, press and hold the Day/Night button and **Home** icon.



10. Select OK.



11. Go to SOFTWARE UPDATE CONFIRMATION to confirm the software update.

#### SOFTWARE UPDATE CONFIRMATION PROCEDURE

After the version update is complete, you must confirm that the software is up-to-date.

1. From the HOME screen, press the Day/Night button, **MENU** icon, and VOL/Power/AUDIO knob in sequence and hold them for about **5 seconds**.



2. Select Detail Information & Setting.



3. From the **Detail Information & Setting** screen, press and hold the **MENU** icon for **5 seconds** until the display changes to the **Developer Diag** screen.

Detail Information & Setting	Return
Monitor Check	•
Unit Check	
Audio Check	
Guideline Setup	
Functional Setup	<b>V</b>

4. From the **Developer Diag** screen, select **Detail Version Info** and confirm the **TEGRA Build Version** and **SH Main Software Version**.

Developer Diag	Return
FAN Control	
PiPiPon Configration	
Detail Version Info	
Bitmap Display	
Steer Angle Adjustment Result	

Models With	Navigation (DA+)		Models Withou	t Navigation (DA)	
Detail Version Info		Return	Detail Version Info		Return
TEGRA Android Version: TEGRA Kernel Version:	4.0.4 Linux version 3.1.10 (build@build-VirtualBox) (gcc version 4.4.3 (GCC) #2 SMP PREEMPT Fri Nov 9 14:40:21 JST 2018		TEGRA Android Version: TEGRA Kernel Version:	#2 SMP PRE	-VirtualBox) 4.4.3 (GCC) )
TEGRA Build Version:	82.01C.00.B.1025 17ada1gKA.20181109.14 0427		TEGRA Build Version:	82.01C.00.B.	
TEGRA Nonvolatile Version:	V001		TEGRA Nonvolatile Version:	V001	
TEGRA Car Parameter:	A10E28A2		TEGRA Car Parameter:	A10E28A2	V
TEGRA Camera Guideline:	00090004		TEGRA Camera Guideline:	00090004	
Software Details		New	Software Versions		
		Mode	els with Navigation		Models without Navigation
TEGRA Build Versio	n	82.01	C.00.B.1025		82.01C.00.B.1021

T5AR04

Touch Version

T5AR04

- 5. Insert the USB flash drive into the USB port to start the factory data reset (FDR) procedure.
- 6. A screen will automatically appear with the prompt Would you like to update?. Select FDR.

## NOTE

The FDR takes about 3 minutes to complete.

	$\sim 0$	~	AUDIO SOURCE
	pdate?	Would you like to upd	
	New	Current	
8.1021	1 82.01C.00.B T5AR04	32.01C.00.B.1021 F5AR04	Tegra Touch
		No	FDR
	Yes	No	FDR

7. After the FDR is complete, the following screen will appear. To bypass this screen, press and hold the Day/Night button and **Home** icon.



8. Select **OK**, and park the vehicle outside in an open area to acquire the GPS signal.



9. Once the procedure is complete, input the customer's audio unit presets, and have the service advisor tell the customer that any previously paired devices must be paired again. After informing the customer about the need for pairing, make sure to document it on the repair order.

END