

SSM 47926 - 2018-2019 F-150/Expedition/Navigator/Transit/Explorer - Illuminated MalfunctionIndicator Lamp (MIL) With Diagnostic Trouble Code (DTC) P025A

Some 2018-2019 F-150, Expedition, Navigator, Transit and Explorer vehicles may exhibit an illuminated MIL with DTC P025A stored in the powertrain control module (PCM). This may be due to an intermittent or partial disconnect of the harness to the fuel pump driver module (FPDM) connector. Confirm FPDM connector (F-150 C4336, Expedition/Navigator C433, Transit C433, Explorer C3239) is fully seated prior to performing PC/ED diagnostics or replacing any components.

APPLICABLE VEHICLES

2018 - 2019 TRUCK: EXPEDITION

2018 - 2019 TRUCK: EXPLORER

2018 - 2019 TRUCK: F-150

2018 - 2019 TRUCK: NAVIGATOR

2018 - 2019 TRUCK: TRANSIT