GLOBAL SAFETY FIELD INVESTIGATIONS DCS5008 URGENT - DISTRIBUTE IMMEDIATELY

Date: March 29, 2019

Subject: N192210330 - Service Update

Cruise Control Indicator and Digital Speed Not Displaying (U.S. Only)

Models: 2019 Chevrolet Silverado 1500 (New Model)

Equipped with Display Instrument (RPO UDD)

To: All General Motors Dealers

General Motors is releasing Service Update N192210330 today. The total number of U.S. vehicles involved is approximately 7. Please see the attached bulletin for details.

Global Warranty Management (GWM)

The Investigate Vehicle History (IVH) screen in the GWM system will be updated March 29, 2019. A list of involved vehicles is attached to this message. Please hold all warranty transactions until IVH has been updated.

END OF MESSAGE GLOBAL SAFETY FIELD INVESTIGATIONS

Service Update

N192210330 Cruise Control Indicator and Digital Speed Not Displaying (U.S. Only)



Release Date: March 2019 Revision: 00

Attention: This service update includes vehicles in dealer inventory and customer vehicles that return to the dealership for any reason. This bulletin will expire at the end of the involved vehicle's New Vehicle Limited Warranty period.

		Model Year			
Make	Model	From	То	RPO	Description
Chevrolet	Silverado 1500 (New Model)	2019	2019	UDD	Display Instrument-Driver Info Enhanced (Multi Color Standard Graphic)

Involved vehicles are marked "open" on the Investigate Vehicle History screen in GM Global Warranty Management system. This site should always be checked to confirm vehicle involvement prior to beginning any required inspections and/or repairs.

Condition	Certain 2019 model year Chevrolet Silverado 1500 (New Model) vehicles received an instrument panel cluster (IPC) service calibration which may prevent the cruise control indicator and digital speed from
	displaying.
Correction	Dealers are to reprogram the IPC.

Parts

No parts are required for this repair.

Warranty Information

Labor		Labor	Trans.	Net
Operation	Description	Time	Type	Item
9104408*	Verified Module Software or Calibration Level: Module	0.2	ZFAT	N/A
	Programmed with Same Level Software or Calibration			
9104232*	Instrument Cluster Reprogramming with SPS	0.3		

^{*} To avoid warranty transaction rejections, the SPS Warranty Claim Code must be entered when submitting this transaction. Note that if multiple modules are reprogrammed, all claim codes must be entered with a comma separating each code.

Warranty Claim Code Information Retrieval

If the SPS Warranty Claim Code was not recorded on the Job Card, the code can be retrieved in the SPS system as follows:

- Open TIS on the computer used to program the vehicle
- Select and start SPS
- Select Settings
- Select the Warranty Claim Code tab

The VIN, Warranty Claim Code and Date/Time will be listed on a roster of recent programming events. If the code is retrievable, dealers should resubmit the transaction making sure to include the code in the SPS Warranty Claim Code field.

Service Procedure


Note: Carefully read and follow the instructions below.

- Ensure the programming tool is equipped with the latest software and is securely connected to the data link connector. If there is an interruption during programming, programming failure or control module damage may occur.
- Stable battery voltage is critical during programming. Any fluctuation, spiking, over voltage or loss of voltage will
 interrupt programming. Install a GM Authorized Programming Support Tool to maintain system voltage. Refer to
 www.gmdesolutions.com for further information. If not available, connect a fully charged 12 V jumper or booster
 pack disconnected from the AC voltage supply. DO NOT connect a battery charger.
- Turn OFF or disable systems that may put a load on the vehicles battery such as; interior lights, exterior lights (including daytime running lights), HVAC, radio, etc.
- Clear DTCs after programming is complete. Clearing powertrain DTCs will set the Inspection/Maintenance (I/M) system status indicators to NO.

Service Update


N192210330 Cruise Control Indicator and Digital Speed Not Displaying (U.S. Only)



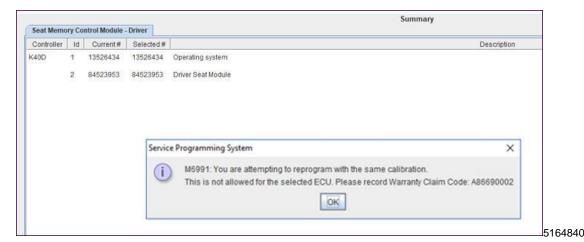

Note: If the Same Calibration/Software Warning is noted on the SPS Summary screen, record the warranty claim code (WCC) and select OK and follow screen instructions. The WCC is located in the Service Programming System dialogue box of the SPS Summary screen. No further action is required. Refer to the Warranty section of the bulletin.

 Reprogram the Instrument Panel Cluster. Refer to P16 Instrument Custer – Programming, Setup and Configuration in SI.

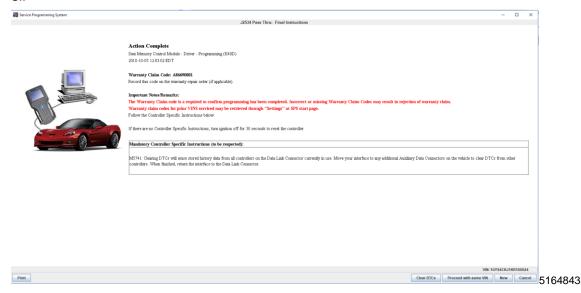

2. Record SPS Warranty Claim Code on job card for warranty transaction submission.

Dealer Responsibility

Whenever a vehicle subject to this service update enters your vehicle inventory or is in your facility for service in the future, and the vehicle is still covered under the New Vehicle Limited Warranty, you must take the steps necessary to be sure the service update correction has been made before selling or releasing the vehicle.

All new, used, GM Certified Used, courtesy transportation vehicles, dealer shuttle vehicles, etc. in dealers' possession and subject to this bulletin <u>must</u> be held and inspected/repaired per the service procedure of this bulletin <u>before</u> customers take possession of these vehicles. Involved vehicles must be held and not delivered to customers, dealer-traded, released to auction, used for demonstration, or any other purpose.

All GM Certified Used vehicles currently in the dealers' inventory within the Certified Pre-Owned Inventory System (CPOIS) will be de-certified and must be held and remedied per the service procedure in this bulletin. Upon submitting an accepted/paid warranty transaction in the Global Warranty Management (GWM) system, the vehicle can be re-certified for sale within the CPOIS system, or once again be used in the CTP program.

