

Voice Prompts and Beeps Inoperative - JBL Equipped

Service

Category Audio/Visual/Telematics

Section Navigation/Multi Info Display Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2019	Highlander, Highlander HV	

Introduction

Some 2019 model year Highlander and Highlander Hybrid vehicles equipped with JBL audio may exhibit inoperative navigation voice prompts and/or button beeps with the setting ON. Updated amplifiers are available through the exchange program to address this condition. Follow the Repair Procedure in this bulletin to address this condition.

Production Change Information

This bulletin applies to vehicles produced BEFORE the Production Change Effective VINs shown below.

MODEL	PLANT	DRIVETRAIN PRODUCTION CHANGE EFFECTIVE VII	
Highlandor		FWD	5TDYZRFH#KS327465
Highlander	ТММІ	AWD	5TDDZRFH#KS982745
Highlander HV		AWD	5TDDGRFH#KS065294

TOYOTA T-SB-0042-19 April 11, 2019 Page 2 of 2

Voice Prompts and Beeps Inoperative - JBL Equipped

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
860601	R & R Stereo Component Amplifier Assembly	1.4	86280-0E120	87	74

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

PART NUMBER		PART NAME	QTY
PREVIOUS	NEW	FART IVAIVIE	
86280-0E120	86280-0E121	Amplifier Assy, Stereo Component*	1

^{*}Obtain amplifier assembly through the Manufacture Exchange Center with the exception of in-stock vehicles, which require new unit replacement.

Repair Procedure

1. Confirm the condition as described in the Introduction.

Are the voice prompts and/or button beeps inoperative?

- YES Continue to step 2.
- NO This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
- Replace the stereo component amplifier assembly with an exchange unit.

Refer to TIS, applicable model and model year Repair Manual:

• 2019 Highlander:

Audio/Visual/Telematics – Audio/Video – "Audio / Video: Stereo Component Amplifier: Removal / Installation"

2019 Highlander HV:

Audio/Visual/Telematics – Audio/Video – "Audio / Video: Stereo Component Amplifier: Removal / Installation"

3. Confirm normal operation of the vehicle.