



# Service Bulletin

Bulletin No.: 19-NA-068

Date: April, 2019


## TECHNICAL

**Subject: Malfunction Indicator Lamp (MIL) Illuminated, Intermittent Service Messages - DTC's U0073, U0121, U0100 and/or U0101 Set, G103 Inspection**


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	TRAX	2015	2019			All	All
Holden	Trax	2015	2019				

<b>Involved Region or Country</b>	North America, N.A. Export Regions
<b>Additional Options (RPOs)</b>	
<b>Condition</b>	Customer may comment on MIL illuminated, and/or service messages may be displayed intermittently. Technicians may find DTC's U0073, U0121, U0100 and/or U0101 Set.

Cause

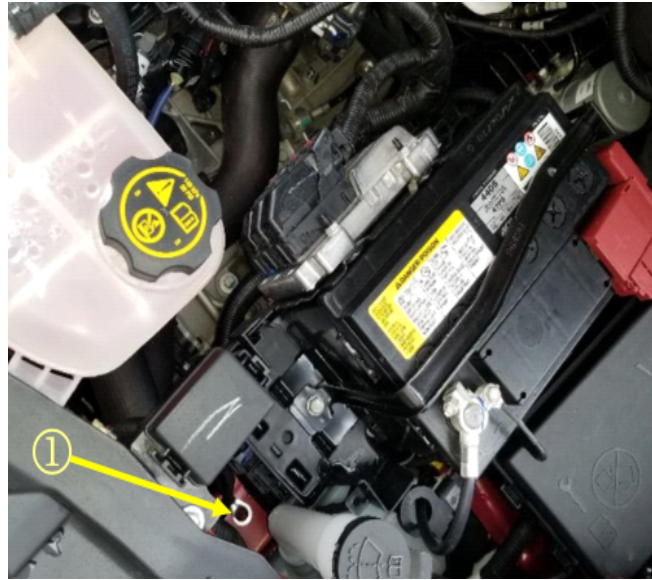


5300153

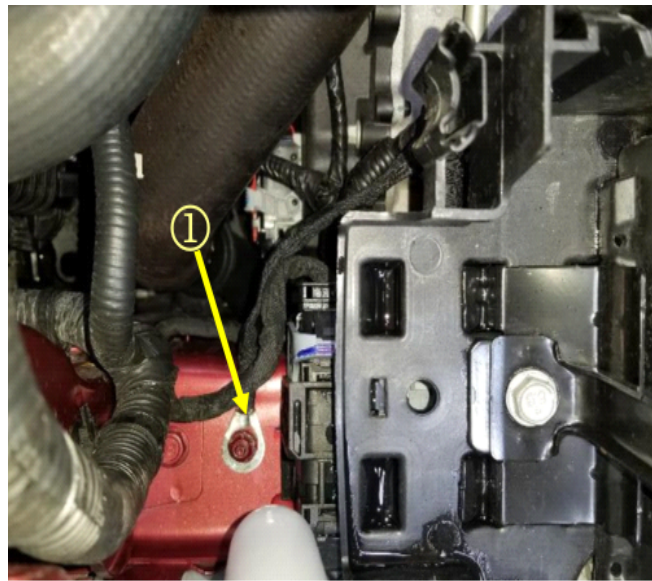

5300152

The cause of the condition may be a poor ground connection at G103 (1), located at the left front frame rail in front of the battery.

<p><b>Correction</b></p>	<div style="text-align: right;">  </div> <p style="text-align: right; font-size: small;">5312724</p> <p><b>Important:</b> Check resistance of the stud, as well as the nut and ground eyelet. If equipped with hex shaped/anti-rotational feature, after cleaning, ensure that the eyelet fully seats down onto the stud hex feature, before torquing the fastener.</p> <p>Perform inspection on ground G103; clean and/or remove paint from the grounds contact points and torque fastener to specification.</p> <p>⇒ Refer to Fastener Specifications in SI.</p>
--------------------------	------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

**Parts Information**

No parts are normally required for this repair.

**Warranty Information**

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
5430962	Ground Connection Repair	Use Published Labor Operation Time

<b>Version</b>	1
<b>Modified</b>	Released April 04, 2019

Keywords: G103

