 
TIS Service Bulletin Page 1 of 2



April 2019 Technical Service

SERVICE ACTION: REPLACE ROLLER BLIND BUTTON

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

MODEL

			11
a a = 0.4=)	ll l	III .	III
$\parallel C07 / V7 \rangle$	l I	III	ll l
$\parallel GU/(\Lambda I)$	ll l	III .	III
OOT (XT)	ll l	III .	III
	ll l	III .	III

Produced from 12/2018-2/2019

AFFECTED VEHICLES

This Service Action involves 209 X7s produced from 12/2018-2/2019.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION


The release buttons for the rear luggage compartment roller cover can break.

CORRECTION

Replace both release buttons for the rear roller cover.

PROCEDURE

1. Using a suitable trim bone tool, for example special tool 64 1 020, release the 4 locking mechanisms for the release buttons (1) in the areas shown below.

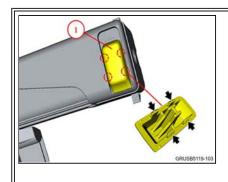

2. Install 2 new release buttons by pressing the button's locking tabs into the roller cover.

PARTS INFORMATION

Part Number	Description	
51 47 9 874 368	Release button on roller cover (ONLY upholstery code MCHE)	2
Or:		

TIS Service Bulletin Page 2 of 2

r upholstery codes) 2	Release button on roller cover (All other upholstery codes)	51 47 9 874 373
-----------------------	---	-----------------

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Completion "before" the first vehicle delivery to a customer or the vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 67 832	11.3 FRU	Replace the release buttons on the roller cover for the luggage compartment (Plus work)

Or:

The vehicle arrives at your center and this Service Action shows open (No other Main work will be performed/claimed during this workshop visit)

	Labor Allowance:	Description:
00 67 244	5 FRU Replace the release buttons on the roller cover for the luggage compartment (Main work)	

[Copyright ©2019 BMW of North America, Inc.]