



Service Bulletin

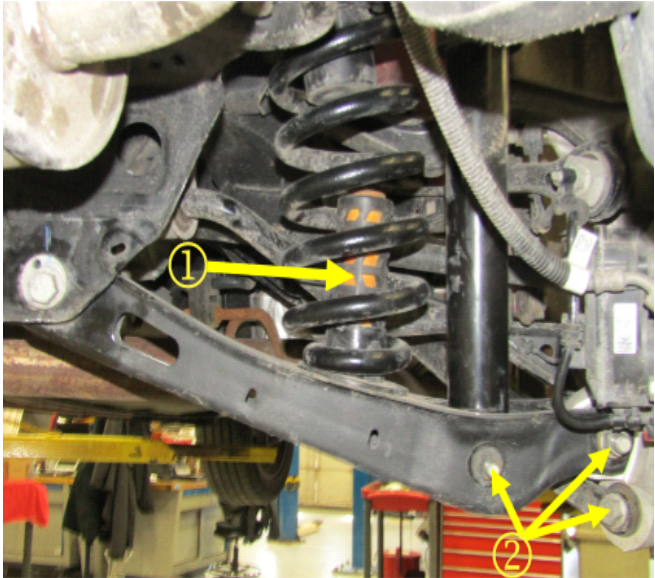
Bulletin No.: 19-NA-070

Date: April, 2019

TECHNICAL

Subject: Squeaking/Creaking Noise from Rear Suspension When Driving on Rough Roads or Over Bumps

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Blazer	2019	2019			All	All

Involved Region or Country	North America, N.A. Export Regions
Additional Options (RPOs)	Equipped with WHEEL-21 X 8.5, J, ALUMINUM, DESIGN 1 (RQM) or WHEEL-21 X 8.5, J, ALUMINUM, DESIGN 2 (ROY)
Condition	Customer may comment on hearing a squeak or creak type noise coming from the rear suspension, when driving on rough roads or over bumps. The condition can occur on the driver, passenger, or in some cases, both sides.
Cause	The cause of the condition may be a poor interface between the lower control arm and the rear suspension jounce bumper.
Correction	 <p style="text-align: right;">5310094</p> <p>Note: When removing the spring(s) to access the rear suspension jounce bumpers (1), it will also be necessary to replace 3 single - use fasteners (2), per side.</p> <p>Verify which side, or both, are affected and replace the rear suspension jounce bumpers (1), on those sides. Refer to <i>Rear Coil Spring Replacement</i>, in SI.</p>

Parts Information

Causal Part	Description	Part Number	Qty
X	BUMPER ASM-RR SUSP JOUNCE	84181736	1 or 2, as necessary
N/A	BOLT/SCREW	11610869	
	BOLT/SCREW	11611841	
	BOLT/SCREW	11610911	

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8042060	Rear Coil Spring Replacement	0.6 hr*
8042070	Rear Coil Spring Replacement - Both Sides	1.1 hr*

* The May 1 update of the Labor Time Guide will contain these changes.

Version	1
Modified	Released April 10, 2019

