



Service Bulletin

Bulletin No.: 19-NA-082

Date: April, 2019

TECHNICAL

Subject: Water Leak From Rear Window Area

Brand:	Model:	Model Year:		Date Breakpoint:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Colorado VIN S, VIN T	2019	2019	SOP	Prior to December 14, 2018	All	All
GMC	Canyon						

Involved Region or Country	North America, N.A. Export Regions
Additional Options (RPOs)	
Condition	Customer may comment on seeing a water leak around the rear window area.

Important: Though sometimes mistakenly attributed to the Center High Mount Stop Lamp (CHMSL), **this leak is not caused by the CHMSL.**



5319670

Cause

The cause of the condition may be that the headliner was positioned too far rearward upon installation. The rear flange portion of the headliner may have been extended too far into the rear window opening and may have interfered with the adhesion of the rear window, at the top.

Note: The graphic below shows several examples of the condition, where a void in the urethane sealing of the window is evident.




5319673

Correction

First verify the condition; then remove the rear window, reposition the rear of the headliner as necessary, and reseal the window, following the steps in the Service Procedure below.

Service Procedure

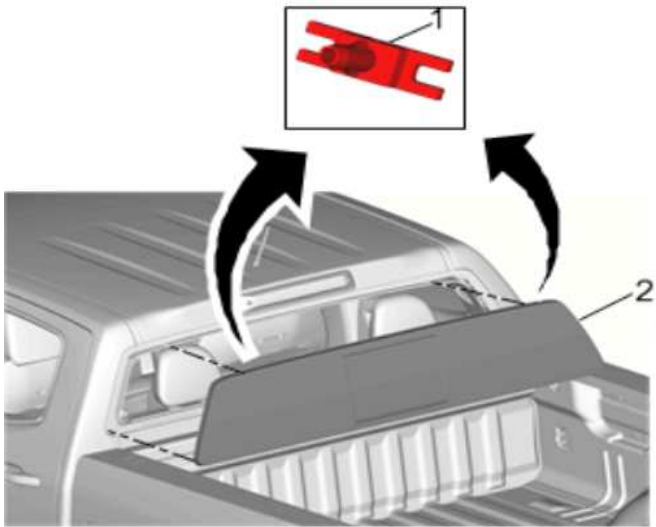


5319676

1. Remove the rear window. Refer to *Rear Window Replacement*, in SI.



5319678

2. Inspect the headliner at the upper window opening and check for possible mis-positioning too far rearward, and extending into the window opening.
3. Roll or tuck the rear of the headliner back under and behind the upper rear roof flange.

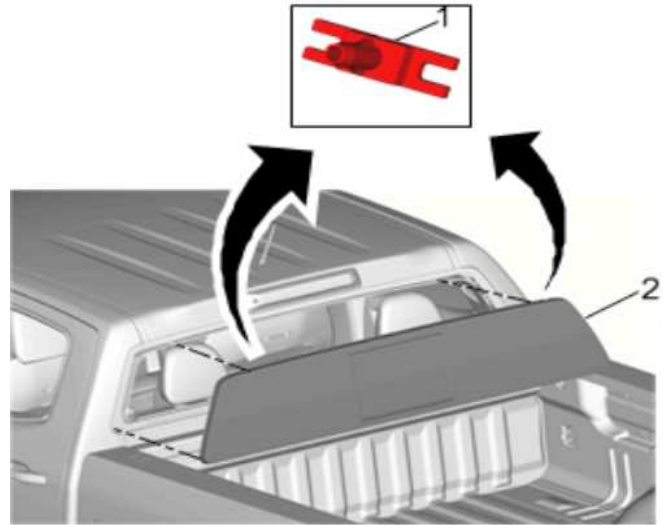

5319676

4. Reinstall and reseal the rear window. Refer to *Rear Window Replacement*, in SI.



5319682

5. Upon completion of the repair, you should be able to reach between the headliner and the window, and pull the headliner away from the glass. **The headliner should not touch the glass at the center.**

Parts Information

No parts are required for this repair.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
0560112	Rear Window Resealing	Use Published Labor Operation Time

Version	1
Modified	Released April 23, 2019

