

Subject: CHECK ENGINE LIGHT ON WITH DTC P0606	Service Alert No.: SA-020/19
	Last Issued: 05/20/2019

BULLETIN NOTES

APPLICABLE MODEL(S)/VINS


2010-2012 CX-7 (with L5 engine)

DESCRIPTION

Some vehicles (with L5 engine only) may exhibit the Check Engine Light ON with DTC P0606. This may be caused by corrosion on the C-31 connector due to moisture.

REPAIR PROCEDURE

1. Verify customer concern.
2. Check connector C-31 for corrosion.

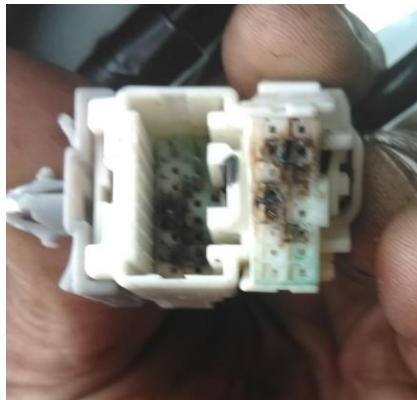


- If there is corrosion, clean the connector using a commercially available electrical cleaner and inspect the area for source of a water leak.

NOTE: If the connector cannot be cleaned using a commercially available electrical cleaner, replacement pins may be available in the terminal repair kit or through Mazda estore.

- If there is no corrosion, diagnosis the concern using MGSS.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

NOTE: C-31 is located at the left rear hatch area of the vehicle.

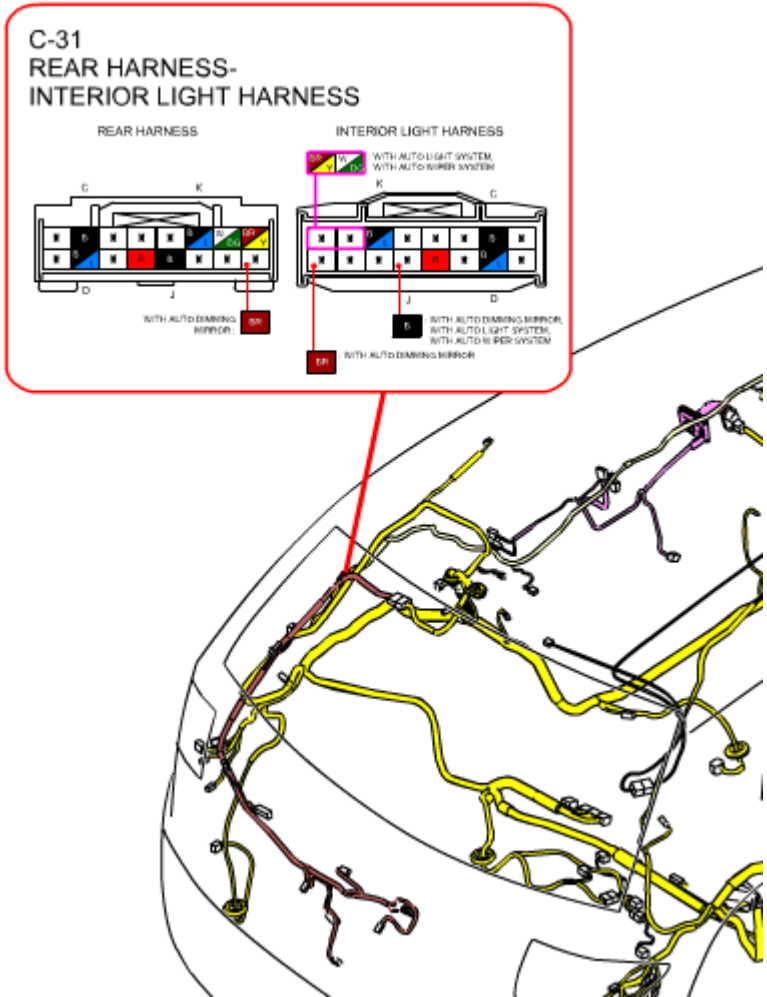

3. Verify the repair.

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.