



## Preliminary Information

### PIP5423B SES Lamp Setting A P0106 And/Or P0506

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CTS-V	2015 - 2019	All	All	6.2 LT4	All
Cadillac	Escalade	2015 - 2019	All	All	6.2 L86	All
Chevrolet	Camaro	2016 - 2019	All	All	6.2 LT1 LT4	All
Chevrolet	Corvette	2014 - 2019	All	All	6.2 LT1 LT4 LT5	All
Chevrolet	Silverado LD	2014 - 2019	All	All	4.3 5.3 6.2 L83 L86 LV3	All
Chevrolet	Silverado 1500 (New Model LD	2019	All	All	4.3 5.3 6.2 L82 L84 L87 LV3	All
Chevrolet	Suburban	2015 - 2019	All	All	5.3 6.2 L83 L86	All
Chevrolet	Tahoe	2015 - 2019	All	All	5.3 6.2 L83 L86	All
GMC	Sierra Limited	2014 - 2019	All	All	4.3 5.3 6.2 L83 L86 LV3	All
GMC	Sierra 1500 (New Model)	2019	All	All	4.3 5.3 6.2 L82 L84 L87 LV3	All
GMC	Yukon	2015 - 2019	All	All	5.3 6.2 L83 L86	All

<b>Involved Region or Country:</b>	<b>North America</b>
<b>Condition:</b>	<b>A vehicle may have a concern of the SES lamp with a P0106 and P0506</b>
<b>Cause:</b>	<b>This maybe caused by a broken valve spring</b>

#### **Correction:**

Replace the broken valve spring if the valve did not drop and cause block damage

#### **Service Procedure:**

Remove the valve cover and inspect for a broken valve spring.

If a broken valve spring is found inspect the intake manifold for a collapsed runner.

#### Version History

Version	2
Modified	09/27/2016 - Created 04/08/2019 - Updated to add Model year and RPO codes. 4/09/2019 - Updated Modle Years and Engine RPOs



GENERAL MOTORS