

Preliminary Information

PIC5978B HPCM2 Fault Code P0606 Control Module Internal Performance

Models

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	rransmissions.
Chevrolet	Volt	2011 - 2015	All	All	All	All
Cadillac	ELR	2014 - 2016	All	All	All	All
Opel	Ampera	2012 - 2014	All	All	All	All

Supersession Statement

This PI was superseded to update Recommendations/Instructions. Please discard PIC5978B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern

This DTC can set in the Hybrid Powertrain Control Module 2 (K114B) during normal vehicle servicing procedures such as clearing codes or connecting the 12 volt battery.

Recommendations / Instructions

Review stored data in GDS2 for the vehicle and locate the first time codes were read on this service visit. If the first code read includes P0606 from the HPCM2, follow normal service procedures.

If the P0606 <u>was not set</u> in the hands of the customer, follow these steps to clear the P0606 in the HPCM2:

- 1) Close all doors and rear hatch
- 2) Press and hold the power button to put the vehicle into service mode.
- 3) Clear the DTC using GDS2
- 4) Power off the vehicle, and
- 5) Open and close the driver's door
- 6) Wait 1 minute
- 7) Start vehicle and ensure MIL is not illuminated

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

















GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.