



Bulletin No.: PIT5662A

Published date: N/A

Preliminary Information

PIT5662A Service Parking Brake Message, Red Park Brake Indicator Flashing & or Amber Parking Brake Wrench Indicator Illuminated. DTC C056D or C056E Could Have Other ABS DTC's

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2018 - 2019	All	All	All	All
Cadillac	XT5	2017 - 2019	All	All	All	All
Chevrolet	Traverse	2018 - 2019	All	All	All	All
GMC	Acadia	2017 - 2019	All	All	All	All

Involved Region or Country	North America
Condition	Service Parking Brake Message, Red Park Indicator Flashing & or Amber Parking Brake Wrench Indicator Illuminated. With DTC C056D or C056E Could Have Other ABS DTC's. If replacing the EBCM will get programming error E6961.
Cause	Resistance in the park brake circuit or Park brake actuator.

Correction:

Measure both rear park brake circuit resistance at the EBCM with the EPB actuators plugged in. Should be 6.0 Ω or less on the circuit.

If resistances are above 6 ohm inspect and repair wiring concern or replace EPB actuator as needed.

If the actuator is replaced make sure the O ring is seated between the EPB actuator and caliper.

If you had programming error E6961 after repairing wiring or replacing actuator you may need to power down the EBCM for over 5 minutes before programming.

Note: This PI may be converted to a Bulletin in the future if new information becomes available.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	03/06/2019 - Created on. 04/25/2019 - Updated correction section



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.