

FLA COE  
FLB COE  
FLD Conventional  
Business Class  
FLC 112 Conventional

Century Class Conventional  
Argosy COE  
Cargo  
Columbia  
122SD and Coronado

Business Class M2  
> Cascadia  
108SD/114SD  
> New Cascadia

**Freightliner  
Service Bulletin**


## General Information

On some Cascadia and New Cascadia vehicles the exhauster splash cover may come loose or fall off the cab exhauster, often when washing the vehicle. This can happen when all four latch tabs of the splash cover are not fully latched onto the cab exhauster.

If a splash cover becomes loose or falls off, install the splash cover onto the cab exhauster using the procedures in this bulletin.

## Exhauster Splash Cover Installation

See [Fig.1](#) for the location of the latches on the cab exhauster that snap into the cab exhauster splash cover.

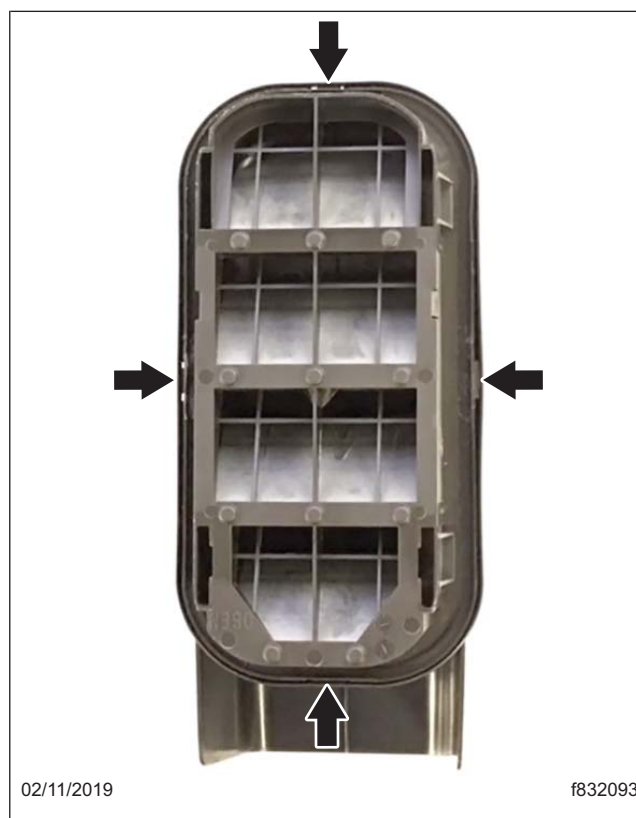

**Fig. 1, Location of Cab Exhauster Latches for Cab Exhauster Splash Cover**

1. Park the vehicle, shut down the engine, and apply the parking brakes. Chock the tires.

### NOTICE

**Use caution when removing the cab exhauster so as not to scratch the cab paint.**

2. Carefully remove the cab exhauster (part number A 901 830 00 42) from the back wall of the cab by releasing the four lock tabs (two on each side).

### Freightliner Service Bulletin

FLA COE  
FLB COE  
FLD Conventional  
Business Class  
FLC 112 Conventional

Century Class Conventional  
Argosy COE  
Cargo  
Columbia  
122SD and Coronado

Business Class M2  
> Cascadia  
108SD/114SD  
> New Cascadia

3. Fully engage the bottom latch of the cab exhauster with the splash cover (part number 22-73755-000). There should be an audible click when the latches engage. See [Fig. 2](#).



**Fig. 2, Engaging the Bottom Latch**

4. Firmly hold the cab exhauster and splash cover together, then using a flat-headed screwdriver, push the latch tab to engage the top latch. See [Fig. 3](#).

# Exhauster Splash Covers Do Not Fully Latch

# 60-165

FLA COE  
FLB COE  
FLD Conventional  
Business Class  
FLC 112 Conventional

Century Class Conventional  
Argosy COE  
Cargo  
Columbia  
122SD and Coronado

Business Class M2  
> Cascadia  
108SD/114SD  
> New Cascadia

Freightliner  
Service Bulletin



**Fig. 3, Engaging the Top Latch**

5. Use the flat-head screwdriver to push the latch tabs to engage the side latches. See [Fig. 4](#).

### Freightliner Service Bulletin

FLA COE  
FLB COE  
FLD Conventional  
Business Class  
FLC 112 Conventional

Century Class Conventional  
Argosy COE  
Cargo  
Columbia  
122SD and Coronado

Business Class M2  
> Cascadia  
108SD/114SD  
> New Cascadia



**Fig. 4, Engaging the Side Latches**

6. Install the assembly into the back wall of the cab, pushing it into place. It should be flat against the back wall of the cab and feel firmly set in place. See [Fig. 5](#).

# Exhauster Splash Covers Do Not Fully Latch


# 60-165

FLA COE  
FLB COE  
FLD Conventional  
Business Class  
FLC 112 Conventional

Century Class Conventional  
Argosy COE  
Cargo  
Columbia  
122SD and Coronado

Business Class M2  
> Cascadia  
108SD/114SD  
> New Cascadia

**Freightliner  
Service Bulletin**

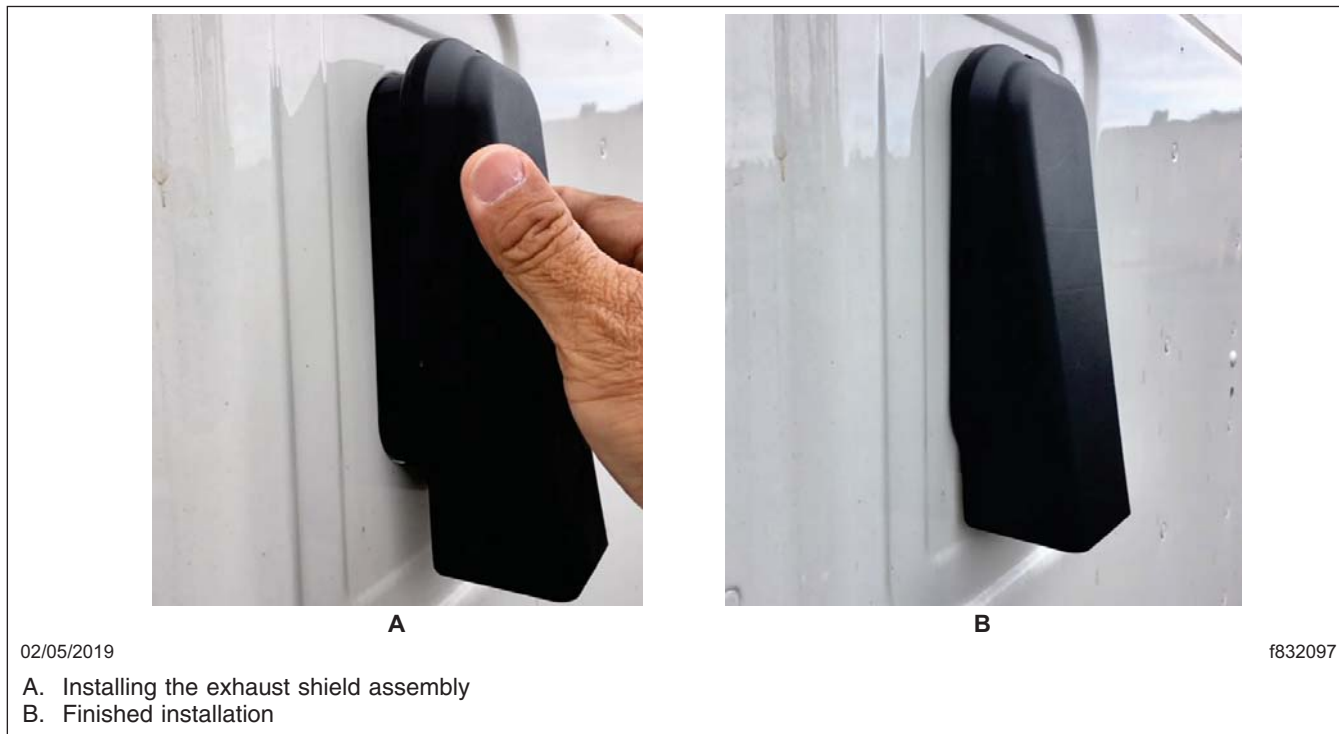

**Fig. 5, Installing the Assembly on the Back Wall of the Cab**

## Warranty

This is an informational bulletin. Warranty does not apply.