



GROUP ELE	MODEL 2020MY Telluride (ON)
NUMBER 168	DATE May 2019

TECHNICAL SERVICE BULLETIN

**SUBJECT: SERVICE ACTION: ELECTRONIC PARKING BRAKE
CONNECTOR INSPECTION AND/OR ADJUSTMENT (SA381)**

This bulletin provides information on some 2020MY Telluride (ON) vehicles produced from January 17, 2019 through April 9, 2019, which may exhibit an Electronic Parking Brake (EPB) warning light illuminated. Follow the procedure to ensure the EPB connector is firmly locked in place by performing a pull test. If the connector can be removed without depressing the locking tab, additional steps are required to seat the terminal lock retainer. Kia is requesting the completion of this Service Action on all affected vehicles including dealer stock, prior to delivery. Before conducting the procedure, verify the vehicle is included in the list of affected VINs.



* NOTICE

A Service Action is a repair program without customer notification that is performed during the warranty period. Any dealer requesting to perform this repair outside the warranty period will require DPSM approval.

Repair status for a VIN is provided on WebDCS (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on WebDCS (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

This issue number is **SA381**.

File Under: <Electrical>

Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair

SERVICE ACTION: EPB WARNING LIGHT CONNECTOR INSPECTION AND ADJUSTMENT (SA381)

Inspection Procedure:


1. Locate the EPB connector in the left rear axle area, behind the rear wheel area as shown.



2. Attempt to pull EBP connector (A) upward.


If EBP connector does not release, there is no concern. This action is complete.

If EBP connector does release, proceed to Step 3.

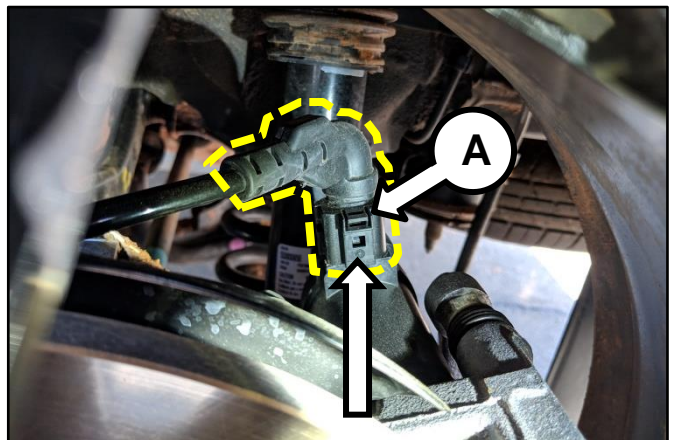


3. Check the terminal retainer (B) located inside of the connector (A).

Terminal retainer is fully seated – **Good.**

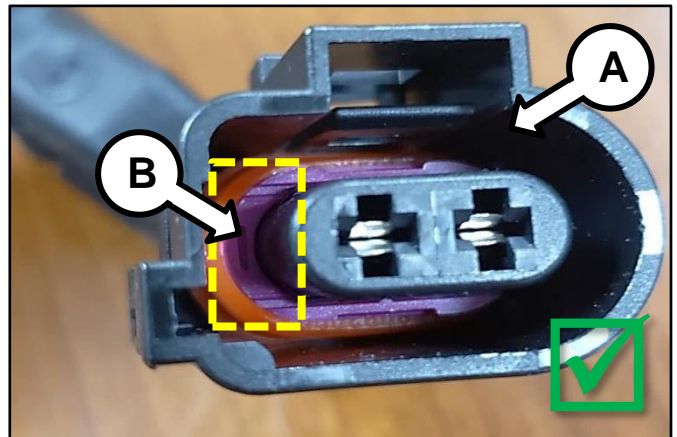

4. If retainer (B) is unlocked as shown, then slide the lock retainer towards the center of the connector as shown using small flathead screwdriver.


Terminal retainer is NOT seated – **NG.**

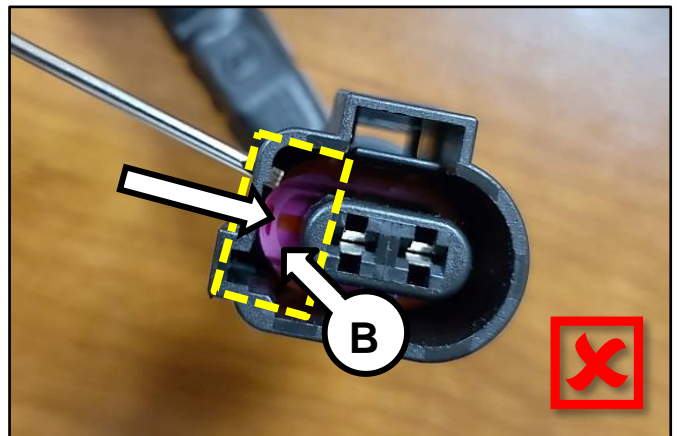


SUBJECT:

SERVICE ACTION: EPB WARNING LIGHT
CONNECTOR INSPECTION AND ADJUSTMENT (SA381)

5. Verify terminal retainer (B) is fully seated against the center of the connector.

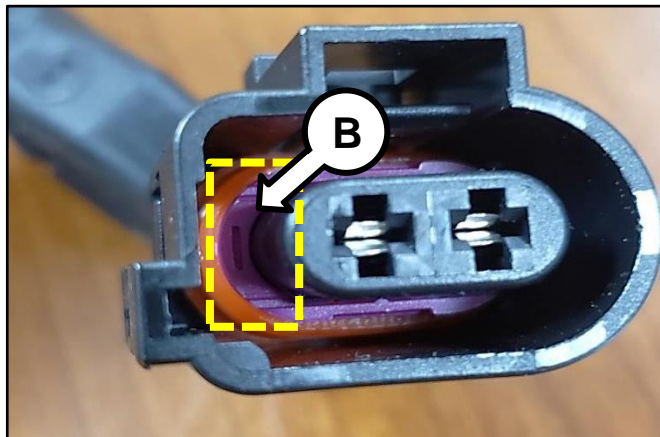

6. Re-install the EPB connector (A) at the caliper (verify clicking sound from locking tab) and perform push/pull to confirm the connector is secured.

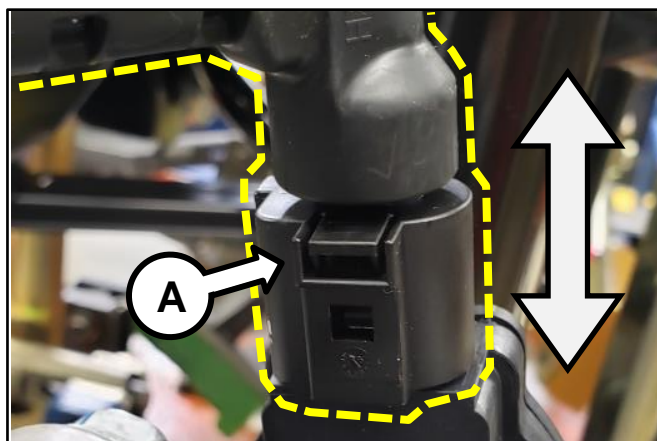

7. Verify proper EPB operation.

SUBJECT:

**SERVICE ACTION: EPB WARNING LIGHT
CONNECTOR INSPECTION AND ADJUSTMENT (SA381)**

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Telluride (ON)	January 17, 2019 through April 9, 2019

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
V	91510 S9110	0	(SA381) EPB Warning Light Connector Inspection	190A15I0	0.2 M/H	NA	0
			(SA381) EPB Warning Light Connector Inspection and Adjustment	190A15R0			

*** NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference SA381 when accessing the WebDCS system.