

TECHNICAL SERVICE BULLETIN 1.0L EcoBoost - Illuminated MIL With DTC P051B - Built On Or Before 16-May-2019

19-2164

23 May 2019

Model:

Ford 2018-2019 EcoSport

Issue: Some 2018-2019 EcoSport vehicles equipped with a 1.0L EcoBoost engine built on or before 16-May-2019 may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P051B. This may be due to sensor drift on the crankcase ventilation sensor thresholds. To correct the condition, follow the Service Procedure to reprogram the powertrain control module (PCM).

Action: Follow the Service Procedure to correct the condition on vehicles that meet all of the following criteria:

- 2018-2019 EcoSport
- 1.0L EcoBoost engine
- DTC P051B present

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2018-2019 EcoSport 1.0L EcoBoost: Retrieve DTCs And Reprogram The PCM (Do Not Use With Any Other Labor Operations)	192164A	0.4 Hrs.

Repair/Claim Coding

Causal Part:	RECALEM
Condition Code:	04

Service Procedure

1. Reprogram the PCM using the latest software level of the appropriate Ford diagnostic scan tool.

NOTE: ADVISE THE CUSTOMER THAT THIS VEHICLE IS EQUIPPED WITH AN ADAPTIVE TRANSMISSION SHIFT STRATEGY WHICH ALLOWS THE VEHICLE'S COMPUTER TO LEARN THE TRANSMISSION'S UNIQUE PARAMETERS AND IMPROVE SHIFT QUALITY. WHEN THE ADAPTIVE STRATEGY IS RESET, THE COMPUTER WILL BEGIN A RE-LEARNING PROCESS. THIS RE-LEARNING PROCESS MAY RESULT IN FIRMER THAN NORMAL UPSHIFTS AND DOWNSHIFTS FOR SEVERAL DAYS.

© 2019 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides

information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.