



Preliminary Information

PIP5644 E92 Controller with four O2 sensor DTC's P0132, P0137, P0152, P0157

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015 - 2018	All	All	6.2L L86	All
Chevrolet	Silverado	2014 - 2018	All	All	4.3L 5.3L 6.2L L83 L86 LV3	All
Chevrolet	Suburban	2015 - 2018	All	All	5.3L 6.2L L83 L86	All
Chevrolet	Tahoe	2015 - 2018	All	All	5.3L 6.2L L83 L86	All
GMC	Sierra	2014 - 2018	All	All	4.3L 5.3L 6.2L L83 L86 LV3	All
GMC	Yukon	2015 - 2018	All	All	5.3L 6.2L L83 L86	All

Involved Region or Country	North America
Condition	Check Engine Light on and vehicle runs rough. This condition will occur within the first 5 minutes after the vehicle is started.
Cause	This condition may be caused by a software anomaly that allows all four DTC's P0132, P0137, P0152, P0157 to set. All 4 DTCs must be in history for this PI to apply.

Correction:

This condition is currently under investigation.

If you experience the condition as described above evaluate the vehicle for any other concerns.

If no other concerns are found and you have the concern noted above it will be necessary to clear the codes and release the vehicle to customer.

Note: We will update the PI or create a bulletin to replace this PI when more information becomes available.

Please ensure you use the following special labor operation for this concern.

Do not use the CCND labor op.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4086988	Check and Clear Codes	0.3 HR

*This is a unique Labor Operation for Bulletin use only.

Version History

Version	1
Modified	05/07/2019 - Created on.



© 2019 General Motors. All Rights Reserved.