



# Preliminary Information

## PIC5733C Lock Indicator Flickers and Unable To Clear DTC B2625 After Repairs are Completed

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	ATS	2013 - 2019	ALL	ALL	ALL	ALL

### Supersession Statement

This PI has been updated to update model years. Please discard all copies of PIC5733B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition / Concern

**A technician may find that the DTC B2625 Symptom Code 02 remains as a Current DTC even though repairs have been completed. When this occurs, the Lock indicator lamp will be flickering.**

### Recommendations / Instructions

**IMPORTANT: Do not replace the BCM for this concern.**

**The DTC can be successfully cleared and the Lock Indicator lamp will stop flickering by using the following procedure after correcting the cause of the B2625 DTC:**

- 1. Disconnect the battery negative terminal for 30 seconds.**
- 2. Reconnect the battery. The DTC will be stored as History and you will now be able to use the Clear DTC command to erase the DTC.**

### Warranty Information

**For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.**

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS