



Preliminary Information

PIT5688 Diagnostic Tip: Gurgle noise from Heater Core after Performing 19-NA-007

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2019	All	All	All	All
GMC	Canyon	2015 - 2019	All	All	All	All

Involved Region or Country:	North America
Condition:	Gurgle noise from heater core , may persist after performing 19-NA-007 .
Cause:	Orientation of the filler cap versus the heater core.

It can be difficult to remove the air from the heater core using the N Fill method because the radiator cap and heater core are at about the same height. If the noise persists, raise the front of the vehicle a foot with a hoist, add 400ml coolant to the overflow bottle, remove the radiator cap. Run the engine for an hour running the throttle up to ~1500 RPM 3 or 4 times during the hour. Engineering and eSI is reviewing this condition and may replace this information with a bulletin.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation:	Description:	Labor Time:
4486028	Purge Air From Heater Core	0.4 hrs.

Version History

Version	1
Created	05/20/2019 - Created on.

