



Preliminary Information

PIP5298B SES Traction Control lamp on and Engine Runs Rough with DTC P0300

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2015 - 2019	All	All	6.2 L86	All
Chevrolet	Silverado LD	2014 - 2019	All	All	4.3L LV3 5.3 L83 6.2 L86	All
Chevrolet	Suburban	2015 - 2019	All	All	5.3 L83 6.2 L86	All
Chevrolet	Tahoe	2015 - 2019	All	All	5.3 L83 6.2 L86	All
GMC	Sierra Limited	2014 - 2019	All	All	4.3L LV3 5.3 L83 6.2 L86	All
GMC	Yukon	2015 - 2019	All	All	5.3 L83 6.2 L86	All
GMC	Yukon XL	2015 - 2019	All	All	5.3 L83 6.2 L86	All

Supersession Statement

This PI was superseded to update Model Years. Please discard PIP5298A.


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition / Concern


Some customers may comment on an SES light with DTC P0300 set and/or a rough running engine concern

Recommendations / Instructions


If SI diagnostics have been completed with no trouble found inspect for a possible terminal tension concern on both the ignition coil power feed for a possible cause of the DTC P0300 set and/or a rough running engine, and the X2 connector of the UBEC (Under hood Fuse Block) for an intermittent SES Traction control lamp concern and repair as necessary.

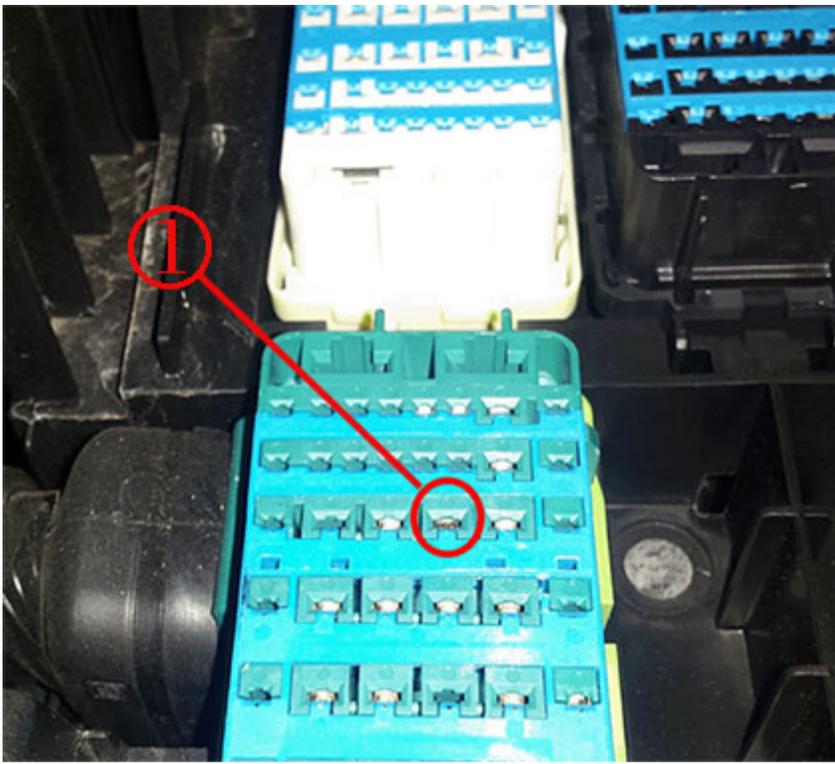

X2 Terminal

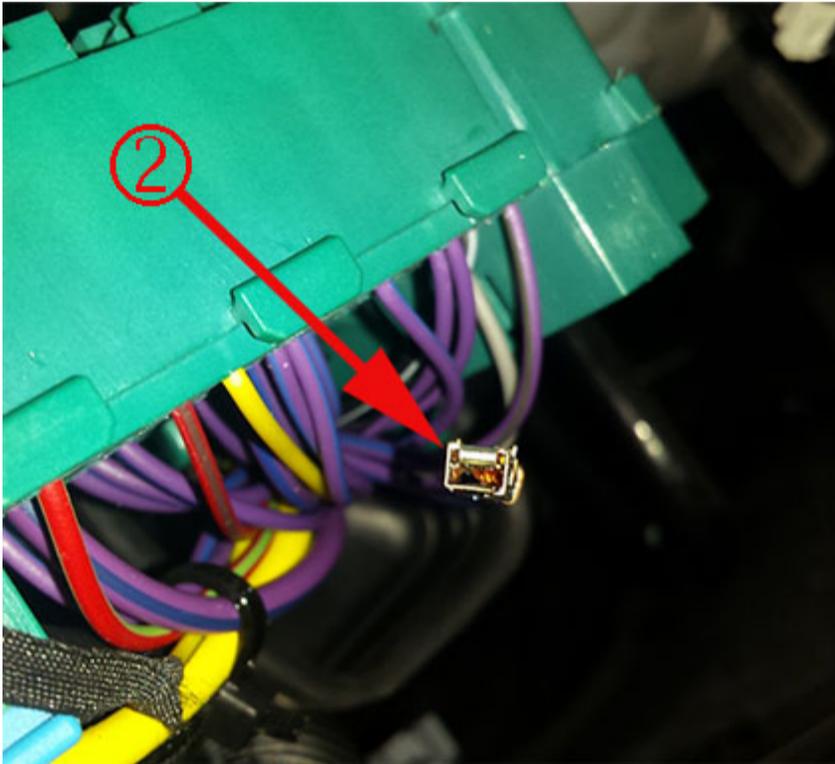

Notice terminal "spread" NO tension

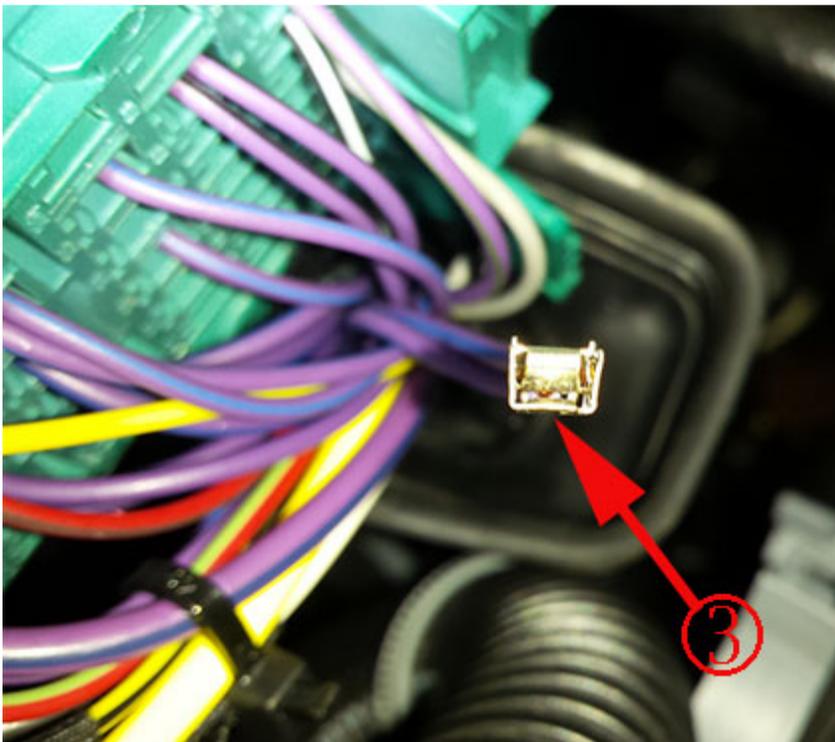

Notice Tighter tension of terminal after repair

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



© 2019 General Motors. All Rights Reserved.