

Parking Brake Adjustment / Calibration Difficult or Not Possible

Vehicles Affected

Model	Model Year	Model Type	VIN Range	Vehicle-Specific Equipment
911 Carrera (all variants)	2017-2018	991	N/A	N/A
718 Boxster/Cayman	2017-2018	982	N/A	N/A

Revision History

Revision	Release Date	Changes
0	May 8, 2019	Original document



Customer Concern

The customer reports the following:

- The parking brake warning is illuminated
- The parking brake has fault codes set for calibration or adjustment
- The parking brake is making noise

Technical Background

Parking brake shoes were manufactured that were too long on one end. This resulted in not enough clearance for the shoe. A visible gap will exist with the new improved shoe, as seen in the photo on the right.

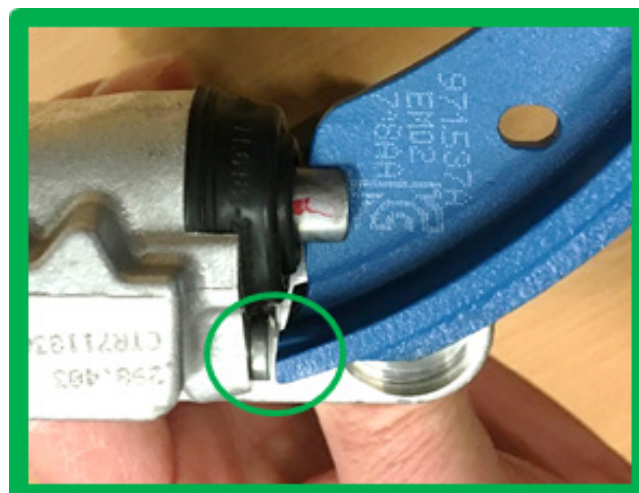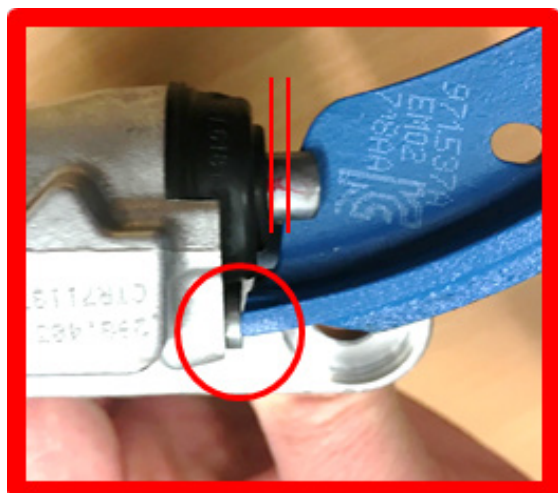

Service Information

Replace the parking brake shoes with new shoes, Part Number 971.698.533.C
Parts stock was purged earlier last year. All parts in stock are known good parts.

If the parking brake actuator has been damaged, replace it as well.

Production Information

Vehicles produced as of August 29, 2018 have the new shoes installed.

Warranty

Please refer to the labor time guide for specifics, as labor times vary depending on model type and variants.

PQIS Coding

Cause Location	46830 Brake shoe
Cause Symptom	1711 Stiff, stuck, too little play

Search Items

Parking brake; parking break; brake calibration; break calibration; brake adjustment; break adjustment ; brake warn-
ing; break warning

Important Notice: Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. Part numbers listed in these bulletins are for reference only. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.
