

SERVICE BULLETIN

 Classification:
 Reference:
 Date:

 EL19-011
 NTB19-042
 May 22, 2019

AEB WARNING LIGHT BLINKING

APPLIED VEHICLES: 2019 Altima (L34) 2015-2019 Murano (Z52)

2016-2019 Maxima (A36) 2016 Murano Hybrid (Z52) 2018-2019 LEAF (ZE1) 2015-2019 Rogue (T32)

2017-2019 Armada (Y62) 2016-2018 Rogue Hybrid (T32H)

2017-2019 Rogue Sport (J11)

APPLIED SYSTEMS: Vehicles equipped with a lane camera (see Figure 1)

SERVICE INFORMATION

If the AEB warning light is blinking (but not illuminated steadily) or the customer states it is blinking, and there are no related DTCs, inspect the windshield.

A blinking AEB warning light may occur under the following conditions:

- When contamination or foreign material adhere to the lane camera viewing window on the windshield
- When driving while it is snowing or when frost forms on the lane camera viewing window on the windshield
- When the lane camera viewing window on the windshield is temporarily fogged up

NOTE:

- If DTCs are present in any of the following related systems:
 - Laser/Radar,
 - ICC/ADAS, or
 - Lane Camera,

Refer to the related Electronic Service Manual (ESM) for diagnosis.

 Refer to the following pages for further information.


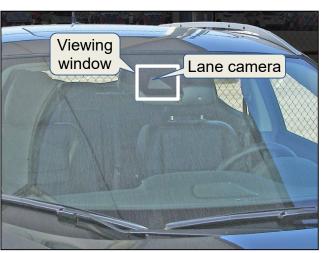


Figure 1

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

FLOW CHART

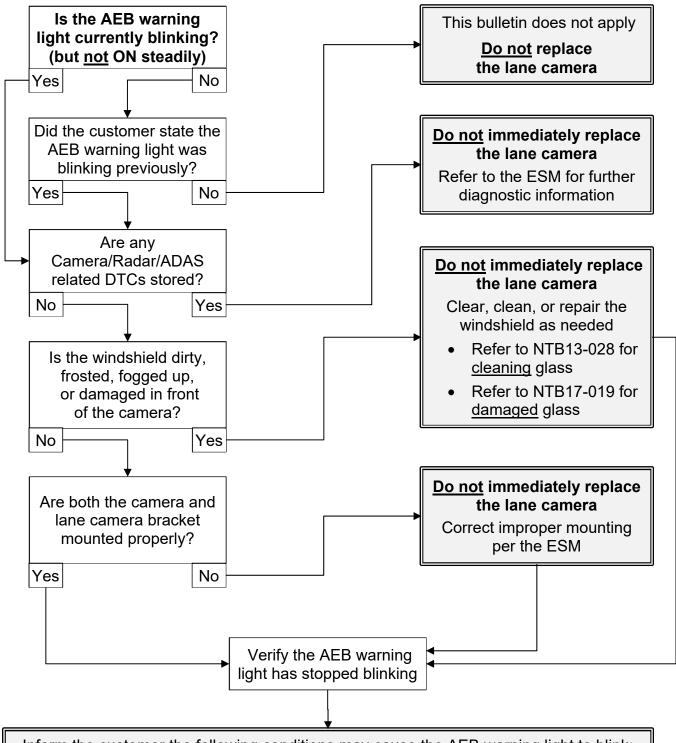

Inform the customer the following conditions may cause the AEB warning light to blink:

- When contamination or foreign material adhere to the lane camera viewing window on the windshield
- When driving while it is snowing or when frost forms on the lane camera viewing window on the windshield
- When the lane camera viewing window on the windshield is temporarily fogged up

Explain to the customer the difference between contamination detection and a malfunction

2/3 NTB19-042

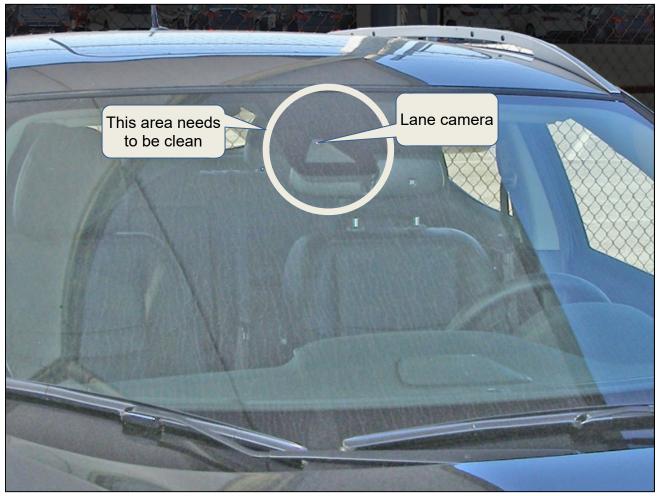


Figure 2

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
May 22, 2019	NTB19-042	Original bulletin published

3/3 NTB19-042