

LATEST VEHICLE CONCERN FIXES



D7U Equipped with AJ126 Hesitation on Acceleration	18 – 19 Range Rover, Range Rover Sport, Discovery
<p><u>Customer Voice:</u></p> <ul style="list-style-type: none">– There is a hesitation when accelerating from a stop or rolling stop.– The vehicle has a lag when pressing the gas then will jump and accelerate. <p><u>Technical Description:</u></p> <ul style="list-style-type: none">– Development of a revised strategy for torque application did not satisfy customers' expectations. <p><u>Status:</u></p> <ul style="list-style-type: none">– The updated calibration has been removed from the tool for 14-17MY vehicles. If a vehicle has been updated already and a customer complaint exists, raise a TA for assistance to install the previous software.– 18-19 MY vehicles: A revised calibration is available for installation with Pathfinder 232. LTB01298 is currently on sign off for 18-19MY vehicles.	<p><i>"Does not drive like previous Range Rovers did."</i></p> <p><i>"Gas pedal hesitates and vehicle does not accelerate"</i></p> <p><i>"No power pulling out, then will jerk while driving"</i></p> <p><i>"Hesitation upon acceleration. Feels like vehicle has no power."</i></p> <div data-bbox="1354 906 1921 1063"></div>

