



REAR LIGHTING/TRUNK CHECK CONTROL MESSAGES DISPLAY

MODEL

G20 (3 Series Sedan)
Produced until February 20, 2019

SITUATION

Various check control messages are present, related to the rear lights and/or trunk. Multiple faults or complaints may be associated with the operation of these systems.

CAUSE

A sharp edge of the trunk lid hinge may damage the wiring harness.

CORRECTION

Repair or replace the trunk wiring harness. Insulate the trunk hinge from causing additional damage.



Note: The trunk repair harness availability is estimated for 7/2019. Until the repair harness becomes available, repair the original wiring harness as needed.

PROCEDURE

1. Remove the right side trunk trim panel following Repair Instructions REP 51 47 161 "Removing and installing/replacing right luggage compartment wheel arch panel".



GRUSB6319-15

2. Closely inspect the wiring harness (arrow) in the area of the right trunk hinge for any signs of damage or chafing against the trunk hinge.

	3. Is damage found to the wiring harness? YES: Continue to step 4. NO: Continue troubleshooting, this bulletin does not apply.
	4. If available, replace the damaged wiring harness with repair harness PN 61 12 9 835 604. If the repair harness is not yet available, the original vehicle wiring should be repaired as needed. Refer to Repair Instructions 61 00 "Notes on handling wiring harness and cables".
 GRUSB6319-16	5. Install foam pad PN 16 11 1 181 918 over the sharp area of the trunk hinge (circled) to prevent additional wiring damage.

PARTS INFORMATION

Part Number	Description	Quantity
16 11 1 181 918	Base (Foam pad)	1

Bulk Materials (use when the replacement wiring harness is not available)

Part Number	Description	Quantity
Refer to ETK	Wire	Sublet as needed
Refer to ETK	Pins	Sublet as needed

Or, when available and needed:

Part Number	Description	Quantity
61 12 9 835 604	Repair wiring set for trunk lid	1

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	61 11 02 79 00	Trunk lid wiring harness incorrect connection/contact fault
Labor Operation:	Labor Allowance:	Description:
51 47 161	Refer to AIR	Removing and installing/replacing right trunk wheel arch panel (Main work)
Or:		
51 47 162	Refer to AIR	Removing and installing/replacing right trunk wheel arch panel (with pass-through system) (Main work)
Or:		
51 47 661	Refer to AIR	Removing and installing/replacing right trunk wheel arch panel (Plus work)
Or:		
51 47 662	Refer to AIR	Removing and installing/replacing right trunk wheel arch panel (with pass-through system) (Plus work)
And if necessary:		
61 00 009	Work time (WT)	Work time as needed, depending on severity of wiring damage, to repair damaged wiring, or to replace with the rear trunk repair harness

Refer to AIR for the corresponding flat rate unit (FRU) allowances.

Work time labor operation code 61 00 009 is not considered a Main labor operation; however, it does require an individual punch time and an explanation on the repair order and in the claim comments section.

And, as needed:

Sublet – Bulk Materials

Sublet Code 4	See the sublet reimbursement calculations below	Reimbursement for the repair-related bulk materials (excluding the repair wiring set for trunk lid part number) (Do not use the other BMW part numbers for claim submission)
----------------------	---	--

Sublet reimbursement calculation for claiming the applicable repair-related bulk materials (BMW part numbers) is at the dealer net price amount for the “quantities used” plus your center's handling.

Enter this material cost in sublet and itemize the amount on the repair order and in claim comment section.