

SI B66 18 19 Drivers Assistance, Remote Control Systems May 2019 Technical Service

BMW DIGITAL KEY CARD IS NOT DETECTED

MODEL

G14 (8 Series Convertible)G15 (8 Series Coupe)G20 (3 Series Sedan)G29 (Z4 Roadster)Produced from March 15, to April 10, 2019

Affected Vehicle equipment:

SA322 Comfort Access in conjunction with SA6NW Wireless Charging Tray

SITUATION

BMW Digital Key card is not recognized or does not work.

The customer can experience the following:

- · BMW Digital Key card is not detected in the wireless charging tray
- · Vehicle cannot be unlocked or locked using the BMW Digital Key card


CAUSE

Damaged BMW Digital Key card.

Damage to the BMW Digital Key card can occur when charging a smart phone in the wireless charging tray, if the phone is placed on top of the Digital Key card.

CORRECTION

Replace the BMW Digital Key card

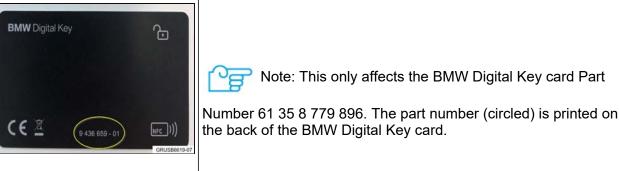

PARTS INFORMATION

Part Number	Description	Quantity
61 35 9 436 659	BMW Digital Key card	1

WARRANTY INFORMATION

This service information bulletin provides technical, diagnostic and/or repair-related information.

A damaged BMW Digital Key card is not defect in materials or workmanship.

[Copyright ©2019 BMW of North America, Inc.]