


| | | |
|---------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------|----------------------------------------|
|  HYUNDAI Technical Service Bulletin | GROUP AUTOMATIC TRANSMISSION | NUMBER 19-AT-003H-1 |
| | DATE MAY, 2019 | MODEL(S) SONATA (YFa) |
| SUBJECT: | AUTOMATIC TRANSMISSION 2-3 SHIFT FLARE | |

This TSB supersedes TSB 19-AT-003H to revise the Parts Information.

Description: This bulletin provides the procedure to identify the correct transmission part number for 2013~14 Sonata (YFa) 2.4L by referring to the Serial Code.

Some transmissions installed during the transition from 2013 to 2014 model years may be mixed from 8/20/2013 to 10/17/2013.

NOTE: An incorrect transmission part number may cause a 2-3 shift flare.


Applicable Vehicles: 2013~14 Sonata (YFa) 2.4L

If an installed transmission has a 2-3 shift flare:

Locate the 12 digit Serial Code of the removed transmission at the location shown in the image.

Refer to Parts Information to confirm the installed transmission was the correct part number according to the first 4 digits of the serial code. If the installed transmission was:

- Incorrect ATM, install the correct ATM.
- Correct ATM, replace the ECU according to the Parts Information below.

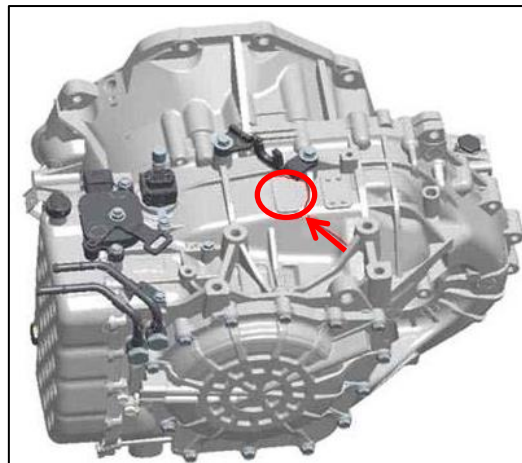

Parts Information:

| Vehicle | Serial Code (1 st 4) | ATM | ECU | TCU CAL ID |
|-----------------------------|---------------------------------|-------------|-------------|------------|
| 2013~14 Sonata(YFa) 2.4L | FA*N | 45000-3BEB0 | 39111-2G673 | TYF0Z24NA9 |
| | FA*X | 45000-3BKNO | 39111-2G678 | TYF0Z24SA8 |

Warranty Information: Normal Warranty Applies

Service Procedure:

1. Remove the air filter box and locate the Serial Code on top of the transmission. Refer to the Parts Information to determine the correct transmission.