

Technical Journal

TITLE:

High Voltage Battery repairs

| REF NO: TJ 34295.1.0 | ISSUING DEPARTMENT: Technical Service | CAR MARKET: United States and Canada | | |
|-------------------------|---------------------------------------|--------------------------------------|-------------------------|--|
| 3 US 7 | PARTNER: '510 Volvo Car USA | ISSUE DATE: 2018-12-06 | STATUS DATE: 2019-04-30 | |
| FUNC GROUP: 3110 | FUNC DESC: Battery | Page | 1 of 3 | |

[&]quot;Right first time in Time"

Attachment

| File Name | File Size | |
|-----------------|-----------|--|
| TJ-34295_US.pdf | 0.0114 MB | |

Vehicle Type

| Type | Eng | Eng Desc | Sales | Body | Gear | Steer | Model Year | Plant | Chassis range | Struc Week Range |
|------|-----|-------------|-------|------|------|-------|------------|-------|---------------|---------------------|
| 2XX | BC | | | | | | 2016-9952 | | - | 201526-999952 |
| 2XX | BR | | | | | | 2016-9952 | | - | 201526-999952 |

CSC Customer Symptom Codes

| Code | Description |
|------|--|
| 2V | Technician information/Software/Vehicle communication/Not for warranty use |

VST Operation Number

DTC Diagnostic Trouble Codes

Text

DESCRIPTION:

Parts, methods & tools are now available to repair almost all faults within the High Voltage Battery.

Technical Journal 34295.1.0



SERVICE:

Repair the battery according to the methods in VIDA.

In the rare event that a complete battery is to be replaced, the battery being installed may not have the same cell chemistry as the battery being removed.

A unique Software Product may be necessary, see attachment.

The Software Product changes the Variant Attribute in the vehicle to match that of the replacement battery.

This Software Product is not needed when a battery module or other internal components are replaced.

VEHICLE REPORT:

In the rare event that a complete battery or battery module is to be replaced, a vehicle report marked Support Needed is required before ordering the battery.

To view TJ attachment continue to next page. This TJ has one attachment.

Page 2 of 3 2019-04-30

| Туре | Model Year | Replacement battery part numbers: 31473177 31491834 | Replacement battery part numbers: 31499073, 32201334, 32202978 32208415, 32223588, 32263256 | Replacement battery part numbers: 31673714 32263448 | |
|---|--------------|---|---|---|--|
| Yeee | 2016 2017 | Software Product 32278420 Valid for Structure Week 15w26-17w16 | Software Product 32263126 | 6 (1 | |
| XC90 (256) | 2018 2019 | Not Supported | Valid for Structure Week 15w26-19w16 | Software Product 32263128 (Valid 15w26-) | |
| | 2020 | | Not Supported | | |
| XC60 (246) | 2018 2019 | Not Supported | Software Product 32263126 Valid for Structure Week 15w26-19w16 | Software Product 32263128 (Valid 15w26-) | |
| (240) | 2020 | | Not Supported | (valid 15w26-) | |
| S90 (238) | 2018 2019 | Software Fre | | Software Product 32263134 (Valid 15w26-) | |
| (236) | 2020 | | Not Supported | (valid 15w20-) | |
| S/V60 2019 (224/225) 2020 | | Not Supported | Software Product 32290007 | Software Product 32290008 | |
| | | Not Supported | Not Supported | | |