



Preliminary Information

PIP5658 Heat Shrink Hose Clamp Information

Models

| Brand: | Model: | Model Years: | VIN: | | Engine: | Transmissions: |
|-----------|--------------------------------|--------------|------|-----|----------|----------------|
| | | | from | to | | |
| Chevrolet | Silverado 4500HD 5500HD 6500HD | 2019 | All | All | 6.6L L5D | All |

| | |
|----------------------------|---|
| Involved Region or Country | North America |
| Condition | There may be a concern where coolant heat shrink clamps need to be replaced for a coolant leak and/or for a service repair. |
| Cause | Difficult to get the heat shrink clamps to seal the coolant hose. |

Correction:

When possible use the heat shrink clamps in the places that they are called for.



Heat shrink clamp

There may be location that may not be accessible to get a heat gun to.

For locations that are inaccessible to a heat gun, use hose clamp p/n 1518389C1, torque @ 9-11 Nm (79 - 97 lb in).

This PI will be deleted as Service information is updated.

Version History

| | |
|----------|-------------------------|
| Version | 1 |
| Modified | 06/10/2019 - Created on |



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.