



Preliminary Information

PIT5609A SES Lamp with DTC U1345

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Enclave	2019	All	All	All	All
Chevrolet	Traverse	2017 - 2019	All	All	All	All

Involved Region or Country	North America
Condition	SES Lamp on with DTC U1345
Cause	Water getting in connection at the upper and lower Aero Shutters

Correction:

Inspect the terminals/connectors at the upper and lower Aero Shutters for water in the connector and/or corroded terminals.

If connection is able to be cleaned up, then clean up the connection and apply di-electric to the terminals and before re-install.

If the connection cannot be cleaned up, replace the connector and apply di-Electric when before re-installing.

Engineering is still investigating the root cause

Note: DO NOT CALL GM Technical Assistant Center. PI will be updated to a bulletin once the final root is understood.

Warranty Information

For wiring repairs covered under warranty please refer to latest version of bulletin [10-00-89-005](#) for warranty information on wire/connector repairs.

Version History

Version	1
Modified	03/27/2018 - Created on 06/13/2019 - Updated Model Years



GENERAL MOTORS