



Preliminary Information

PIT5678A Pop and/or Creak over Bumps from Front End

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2020	all	all	all	all
GMC	Terrain	2018 - 2020	all	all	all	all

Involved Region or Country	North America
Condition	Some customers may comment on a pop and/or creak front the front end over bumps. The noise may sound to be originating from behind the lower control arm at the cradle.
Cause	Excessive movement between the Radiator Sleeve - Lower and the radiator.

Correction:

If excessive play is found between the Radiator Sleeve - Lower and the radiator. Remove sleeve and install flocking tape between radiator and sleeve.

Note: As further information becomes available this PI will be updated or replaced with a bulletin as needed.

Version History

Version	2
Modified	04/30/2019 - Created on 06/28/2019 - Updated Model Years



GENERAL MOTORS