

Outside mirror folding out/in nonfunctional

Topic number	LI72.40-P-069934
Version	1
Function group	72.40 Door control
Date	06-27-2019
Validity	MODEL 205 FACELIFT with code 809 MODEL 213 with code 808 or 809 MODEL 238 with code 809 MODEL 222 FACELIFT with code 808 or 809 MODEL 217 FACELIFT with code 808 or 809
Reason for change	
Reason for block	

Complaint:

The outside mirror cannot be folded in or out.

Cause:

There may be a possible software error in door control unit (N69/1 and N69/2).

Remedy:

Flash door control units DCU/Vx (N69/1 and N69/2) with repair software.

The repair software with add-on 12398 for XD-DVD 03/19 and 05/19 and/or as of XD-DVD 07/19

Note: Replacing parts does not remedy the complaint

Symptoms

Body / Door/Flap / Outside mirror / Power folding mirrors / Malfunction

Control unit/fault code

Control unit	Fault code	Fault text
N69/1 - Left front door (DCU-LF) (DMFL222_MOPF)	-	-
N69/2 - Right front door (DCU-RF) (DMFR222_MOPF)	-	-

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
---------	----------------	------	-------------	------

XENTRY TIPS

			72220 EW	
			72230 EW	