

2019-06-25

[illegible]

Installation of Service Kit

- 1. See Figure 1. Check for vent tube (1).
 - a. If vent tube is present **STOP**, this service procedure has already been performed.
 - b. If vent tube is not present, go to 2.
- 2. Install Inner Primary Vent Service Kit (Part No. 26500027) per the instructions included in the kit.
- 3. Remove transmission inner side cover. See the service manual.
- 4. Inspect for mainshaft transmission oil deflector (Part No. 36300026).
 - a. If the oil deflector is present, remove and discard. Go to 5.
 - b. If the oil deflector is not present, go to 5.
- 5. Install transmission side covers. See service manual.

Credit Procedure

NOTE
Enter bulletin number into comment section of claim.

For vehicles currently under warranty, submit a warranty claim per Table 3.

Table 3.

ITEM	DATA
Claim Type	MC/Standard
Problem Part Number	26500027
Quantity	1
Primary Labor Code	4313
Time	2.1 h
Customer Concern Code	3102
Condition Code	9106

Return Parts

Hold all claimed parts for 60 d from date of credit issued for possible field inspection and/or request to return to factory. After 60 d, destroy and discard the parts.

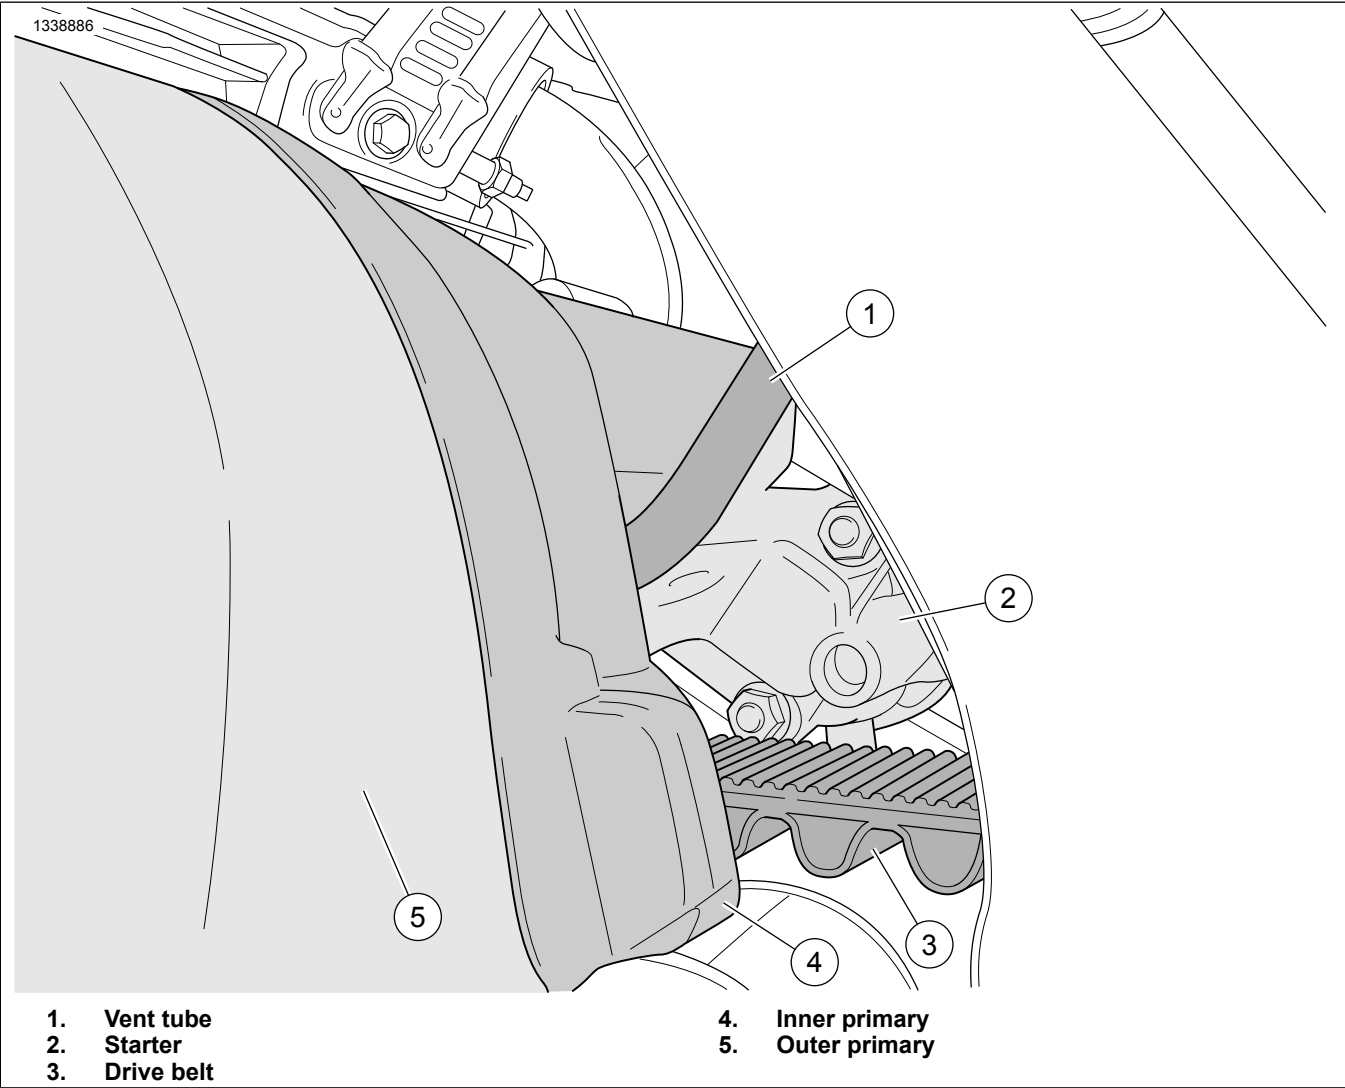


Figure 1. Inner Primary Vent Tube