


# Latest Vehicle Concern Fixes



Telematics Control Unit Software Download Performance	18MY – 20MY E-PACE, F-PACE, I-PACE, F-TYPE, XE, XF, XJ, Range Rover, RR Sport, RR Velar, RR Evoque, Discovery, Discovery Sport																																				
<p><b>Customer Voice:</b></p> <ul style="list-style-type: none"><li>TCU_3 Programming failures</li></ul> <p><b>Technical Description:</b></p> <ul style="list-style-type: none"><li>TCU_3 software download incomplete due to software iteration step</li></ul> <p><b>Status:</b></p> <ul style="list-style-type: none"><li>Software download failure is only present on LG TCU_3 vehicles</li><li>Please follow TOPIx Workshop Manual Guided Flow for TCU diagnosis.<ul style="list-style-type: none"><li>415-01</li></ul></li><li>Pathfinder software download logic will be implemented by end of June.<ul style="list-style-type: none"><li>Including replacement of TCU module if the software is at an old level</li></ul></li></ul>	 <p>ECU Diagnostics &gt; Telematic Control Unit Module [TCU]</p> <p>▲ Software Download did not complete</p> <table border="1"><thead><tr><th colspan="4">Software download status</th></tr><tr><th>Current vehicle information</th><th>Latest software information</th><th>DID</th><th>Status</th></tr></thead><tbody><tr><td>J8A2-70712-DS</td><td>J8A2-70712-DS</td><td>F121</td><td>Update Successful</td></tr><tr><td>J8A2-70712-FR</td><td>J8A2-70712-FS</td><td>F122</td><td>Update Failed</td></tr><tr><td>J8A2-70712-GK</td><td>J8A2-70712-GK</td><td>F123</td><td>Update Successful</td></tr><tr><td>J8A2-70712-AR</td><td>J8A2-70712-AS</td><td>F188</td><td>Update Failed</td></tr><tr><td>J8A2-70712-BS</td><td>J8A2-70712-BS</td><td>F120</td><td>Update Successful</td></tr><tr><td>J7A3-70713-BR</td><td>J7A3-70713-BS</td><td>F124</td><td>Update Failed</td></tr><tr><td>J7A3-70713-JR</td><td>J7A3-70713-JS</td><td>F125</td><td>Update Failed</td></tr></tbody></table>	Software download status				Current vehicle information	Latest software information	DID	Status	J8A2-70712-DS	J8A2-70712-DS	F121	Update Successful	J8A2-70712-FR	J8A2-70712-FS	F122	Update Failed	J8A2-70712-GK	J8A2-70712-GK	F123	Update Successful	J8A2-70712-AR	J8A2-70712-AS	F188	Update Failed	J8A2-70712-BS	J8A2-70712-BS	F120	Update Successful	J7A3-70713-BR	J7A3-70713-BS	F124	Update Failed	J7A3-70713-JR	J7A3-70713-JS	F125	Update Failed
Software download status																																					
Current vehicle information	Latest software information	DID	Status																																		
J8A2-70712-DS	J8A2-70712-DS	F121	Update Successful																																		
J8A2-70712-FR	J8A2-70712-FS	F122	Update Failed																																		
J8A2-70712-GK	J8A2-70712-GK	F123	Update Successful																																		
J8A2-70712-AR	J8A2-70712-AS	F188	Update Failed																																		
J8A2-70712-BS	J8A2-70712-BS	F120	Update Successful																																		
J7A3-70713-BR	J7A3-70713-BS	F124	Update Failed																																		
J7A3-70713-JR	J7A3-70713-JS	F125	Update Failed																																		

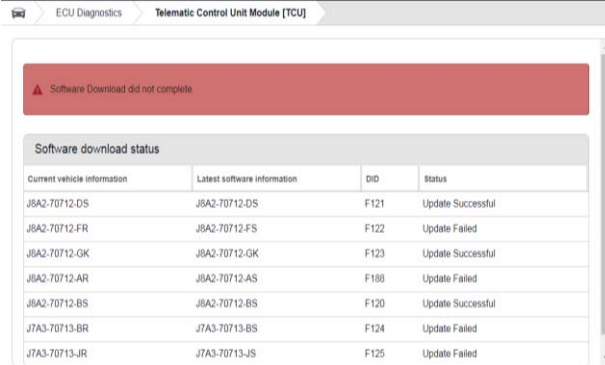