



Service Bulletin

Bulletin No.: 16-NA-324

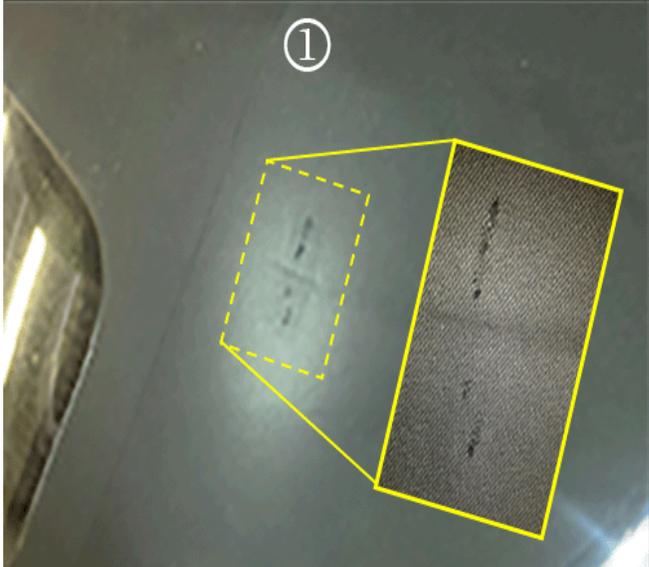
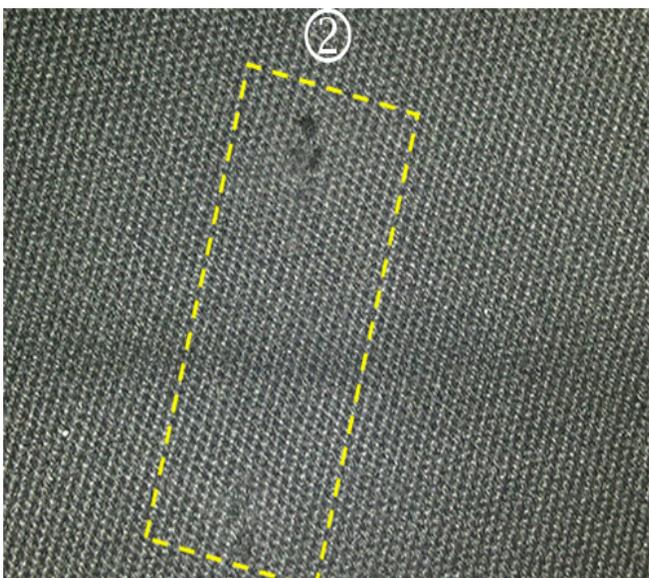
Date: June, 2019

TECHNICAL

Subject: Small Holes Pierced into Sail Panel Area of Folding Top Cover, One/Both Sides

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Cascada	2016	2019			All	All
Holden							

Involved Region or Country	North America, Australia, New Zealand
-----------------------------------	---------------------------------------

<p>Condition</p>	 <p>4585782</p>  <p>4585784</p> <p>Some customers may comment on seeing small pierced holes appearing in the sail panel area, on one or both sides of the folding top cover. Examples of right side (1) and left side (2) damage are shown in the graphics above.</p>
<p>Cause</p>	<p>The cause of the condition may be tension straps sewn into the top cover that were too long in length. This allowed the top cover material to fold into, and be pinched by, the kinematic hinge causing the wear/damage.</p>

Correction



4588587

Note: When replacing the top cover, it will also be necessary to order the fastener kit, shown above, and listed in the part table below, which contains the non-reusable cover fasteners.

Replace the folding top cover. Refer to *Folding Top Cover Replacement* in SI.

Parts Information

Description	Part Number	Qty
COVER ASM-F/TOP (Black)	13426145	1
Cover ASM-F/TOP (Malbec)	13426146	1
Cover ASM-F/TOP (Sweet Mokka)	13426147	1
FASTENER-F/TOP CVR SNAP	13435374	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
6011360	Folding Top Cover Replacement	Use Published Labor Operation Time

Version	2
Modified	Released September 26, 2016 June 24, 2019 – Added the 2018 and 2019 Model Years, Holden Cascada model, Parts Information and Australia, New Zealand to Involved Region or Country.

