



Condition

ATTENTION:

**THIS IS A TECH TIP, NOT A TECHNICAL BULLETIN.
TECH TIPS ARE NOT ASSOCIATED WITH WARRANTY CLAIMING.**

Applicable Vehicles

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Eos	2007-2010	All	All	All	All

Revision Table

Instance Number	Published Date	Version Number	Reason For Update
2031925/7	7/31/2019	61-12-04TT	Update to metadata information.
2031925/6	7/26/2019	61-12-04TT	Update to metadata PR Code information.
2031925/5	7/26/2019	61-12-04TT	Update to model year applicability.
2031925/1	11/26/2012	61-12-04TT	Original publication.

Technical Background

Convertible Top inoperative due to possible loose or disconnected wire splice.

Service

When diagnosing a customer concern of Convertible Top inoperative with faults 03053-008 "Left Roof Pillar Lock Sensor -**G558**- implausible signal", 03055-008 "Rear Window Frame Left Lock Sensor -**G560**- implausible signal", and/or 03057-008 "Rear Window Frame Opening Sensor -**G562**- implausible signal" stored in Convertible Top, start by inspecting M35 splice in Convertible Top harness. The splice is located near left rear Convertible Top Drain, Figure 1.

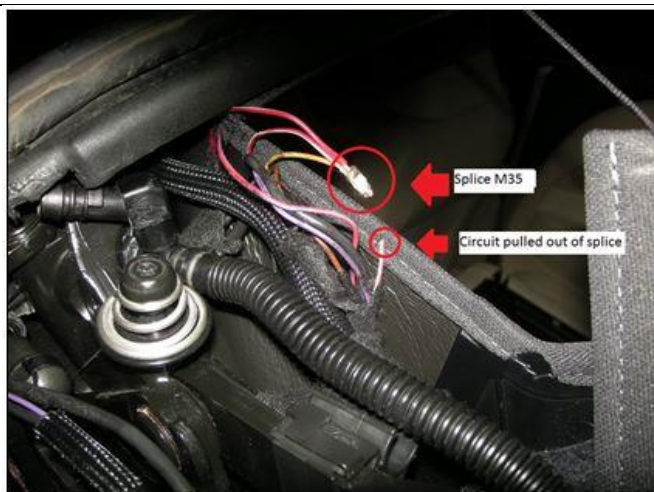


Figure 1

Additional Information

© 2019 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.