ATTENTION:

 
GENERAL MANAGER

PARTS MANAGER

CLAIMS PERSONNEL

SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.



© 2019 Subaru of America, Inc. All rights reserved.



SERVICE BULLETIN

APPLICABILITY: 2019MY Forester NUMBER: 16-123-19

SUBJECT: DTC P173B- Auto Start-Stop System Inoperative **DATE:** 07/30/19

INTRODUCTION:

This bulletin announces availability of a new CVT electric oil pump developed to address DTC P173B: ELECTRIC FLUID PUMP (CVT) PERFORMANCE. The related customer concern describes the Auto Start Stop warning lamp flashing and the system becoming inoperative under certain circumstances. When Auto Start/Stop is inoperative, the vehicle operates like a traditional vehicle not equipped with this feature. The new pumps contain revised judgement logic to eliminate false illumination of the warning lamp.



PRODUCTION CHANGE INFORMATION:

This bulletin will be revised with the starting VIN when it becomes available.

PART INFORMATION:

The part number for the new Oil Pump Assembly is **30726AA001**.

REMINDER: Always order the most up-to-date replacement parts based on the specific VIN being repaired.

SERVICE PROCEDURE / INFORMATION:

REMINDER: Customer satisfaction and retention starts with performing quality repairs.

The service procedures for replacing the pump assembly remain unchanged. Always refer to the applicable Service Manual and review the full requirements of the repair being performed. The Service Manual procedures contain information critical to performing an effective repair the first time and every time. This includes but is not limited to: important SAFETY precautions, proper inspection criteria, necessary special tools, required processes and related one-time-use parts needed for a complete and lasting repair.

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...
Page 1 of 2

Bulletin Number: 16-123-19; Date: 07/30/19

WARRANTY / CLAIM INFORMATION:

For vehicles within the Basic New Car Limited or Powertrain Limited Warranty period or covered by an active Subaru Added Security Powertrain, Classic or Gold plan, this repair may be submitted using the following claim information:

Labor Description	Labor Operation #	Labor Time	Fail Code
CVTF ELECTRIC FLUID PUMP R&R	B811-503	0.4	FCV-42
ENGINE START / STOP SYSTEM DIAGNOSIS	C811-500	0.4	

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.

Continued...

Bulletin Number: 16-123-19; Date: 07/30/19 Page 2 of 2