

SSM 48083 - 2019 MKC - Without Lane Keep Assist – AdvanceTrac, Hill Start Assist Message(s) And/Or Stability Control Indicator Lamp Illuminated With DTCs U0420 And U0415

Some 2019 MKC vehicles without lane keep assist may exhibit an advancetrac, hill start assist message(s) and/or the electronic stability control/traction control indicator lamp illuminated with diagnostic trouble codes (DTCs) U0420 stored in the anti-lock brake module (ABS) and U0415 stored in the power steering control module (PSCM). This concern may also result in additional DTCs. DTCs U0420 and U0415 may have been inadvertently set as a result of low system voltage during a vehicle start. To resolve the concern, reprogram the ABS control module using the latest software level of the appropriate Ford diagnostic scan tool. For claiming, use causal part 2C219 and applicable labor operations in Section 10 of the Service Labor Time Standards (SLTS) Manual.

APPLICABLE VEHICLES
2019 TRUCK: MKC