

SSM 48103 - 2015-2017 Expedition/Navigator - Park Aid Sensor Harness Availability And Repair Direction

Some 2015-2017 Expedition/Navigator front and rear bumper parking aid sensor harnesses FL7Z-15K867-A and BL7Z-15K868-A are currently not available. It is recommended that dealers repair or rebuild these harnesses until harnesses become available. For harness FL7Z-15K867-A, use 9U2Z-14S411-CC pigtail kits for C1428, C1429, C1430, and C1431 (front parking sensor connectors), use CU2Z-14S411-MA pigtail kits for C1322, C1323, C1750 and C1751 (fog lights and DRLs), and CU2Z-14S411-ADA for C110 (bumper-to-body harness). For the BL7Z-15K868-A harness, use 9U2Z-14S411-CC pigtail kits for C4009, C4010, C4011, and C4012 (rear parking sensors), use FU2Z-14S411-DB for C494 (bumper-to-body harness). For unused/open cavities, cut the pigtail wire 1" from the connector and use heat shrink to seal the wire to prevent water entry.

APPLICABLE VEHICLES
2015 - 2017 EXPEDITION
2015 - 2017 NAVIGATOR