

SSM 48108 - 2015-2019 Various Vehicles - No Crank - Security Access Error Code 232: Key Table Not Allocated

Some 2015-2019 vehicles may experience a no crank concern due to a security access key table error. When attempting to program keys or perform a parameter reset, the procedure may fail and the appropriate Ford diagnostic scan tool may display an error 232: Key Table Not Allocated. If this error message is encountered, the body control module (BCM) is internally damaged and requires replacement. The BCM should only be replaced for this condition when the 232 key table error message is present. If the 232 key table error is not present, follow normal diagnostics for the no crank condition. For claiming, use causal part 15604 and applicable labor operations in section 10 of the Service Labor Times Standards (SLTS) manual.

APPLICABLE VEHICLES

2015 - 2019 EDGE
2015 - 2019 F-150
2015 - 2019 FUSION
2017 - 2019 SUPER DUTY
2015 - 2019 MKC
2015 - 2019 MKZ
2015 - 2019 MUSTANG
2016 - 2019 EXPLORER
2016 - 2019 MKX
2016 - 2019 EXPLORER
2017 - 2019 CONTINENTAL
2018 - 2019 EXPEDITION
2018 - 2019 NAVIGATOR
2019 RANGER
2016 - 2019 EXPLORER