



# Preliminary Information

## PIT4713B (Hybrid) Itch Or Rattle Noise From Center Of Instrument Panel

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2009	All *See Note	All *See Note	All	All
Chevrolet	Tahoe	2008 - 2009	All *See Note	All *See Note	All	All
GMC	Yukon	2008 - 2009	All *See Note	All *See Note	All	All

\* with Two-Mode Hybrid System (RPO HP2)

### Supersession Statement:


This PI was superseded to update Recommendation/Instructions. Please discard PIT4713A

### Condition / Concern

A customer may comment about a rattle, Itch, or tapping type noise from the center of the instrument panel area while driving. The cause may be an engine wiring harness making contact with a dowl pin on the forward bulkhead (Back side of the engine compartment)

### Recommendations / Instructions

If you experience this concern, Please remove the engine cover and locate the engine harness as shown in the photo below.

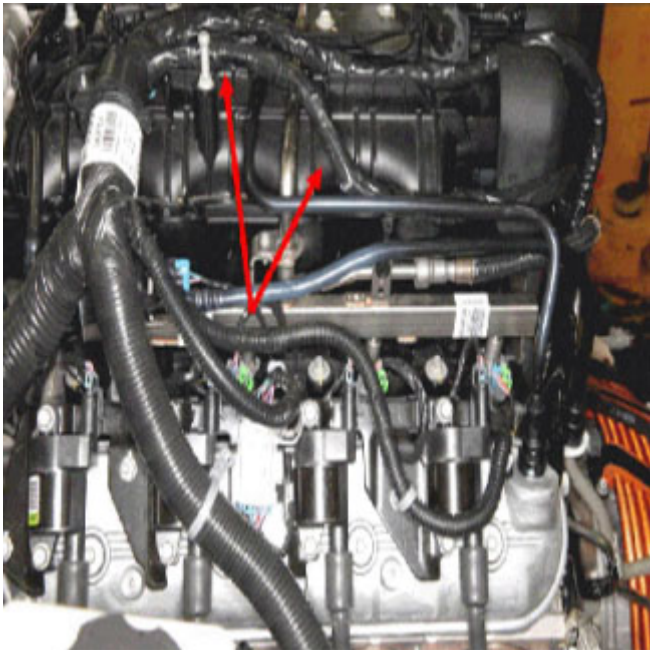


Inspect for a holding clip that secures the engine harness to the fuel line bracket. See Photo Below.



If the holding clip is missing, you will need to get a retaining clip to install.

You will have to remove any slack from the effected engine harness by pulling the harness forward and then installing the clip as shown in the photo below. **(Note: Make sure that you secure the holding clip in the upper hole of the fuel line bracket as shown in the photo).**



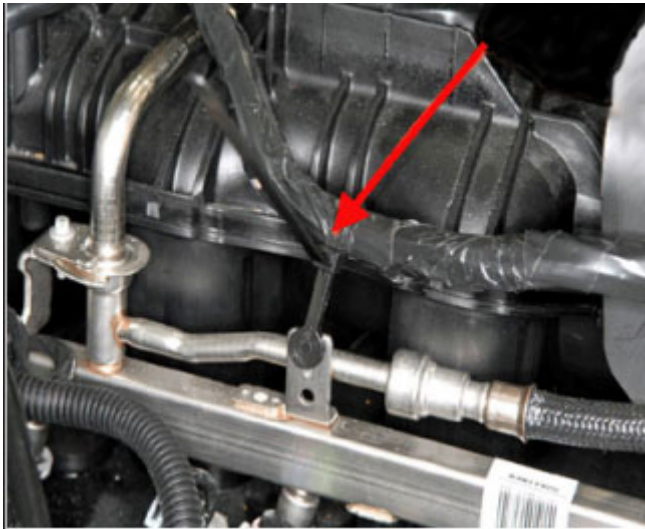

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



© 2019 General Motors. All Rights Reserved.