



Preliminary Information

PIP5660 Diagnostic Tip: MIL Illuminated Possible Reduced Engine Power Message with DTC P2101 and/or P1516 Set as Current or History

Proactive

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	XT4	2019	All	All	2.0 LSY	All
Chevrolet	Silverado 1500 (New Model)	2019	All	All	2.7 L3B	All
GMC	Sierra 1500 (New Model)	2019	All	All	2.7 L3B	All

Involved Region or Country:	North America
Condition:	MIL Illuminated Possible Reduced Engine Power Message with DTC p2101 and/or P1516 Set as Current or History.
Cause:	Possible Throttle Body Internal Gel Contamination Issue.

Correction

If you encounter a vehicle with the above condition complete the latest SI diagnostics for DTC P2101 and/or P1516.

If the published diagnostics lead to ECM replacement and the vehicle was built prior to February 2019 do not replace the ECM.

First, inspect terminal tension at the ECM and throttle body and verify no wiring related issues are present between the ECM and throttle body, if no wiring or terminal related issues were found, replace throttle body assembly using Service Information and retest.

Note: If the vehicle was built after February 2019 and published SI diagnostics has led to ECM replacement, complete the ECM replacement procedure using Service Information and retest.

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation:	Description	Labor Time:
4021510	Throttle body replacement	Use Published Labor Time

Version History

Version	1
Modified	07/15/2019 - Created on



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.