

Latest Vehicle Concern Fixes



Engine Replacement Care Point- Bolt Measurement & Replacement	F-PACE, XE, XF 17-19MY & RR Velar 18-19MY equipped with AJ20D
<p>Technical Description:</p> <ul style="list-style-type: none">• No oil pressure on new engine• Bolts from original engine seem to bottom out on new engine <p>Status:</p> <ul style="list-style-type: none">• TOPIX may require technician to measure the bolts length & replace the bolts. The oil pump is friction drive off the crank pulley requiring the bolts to be the appropriate length. If the bolts are too short, the oil pump never turns causing no oil pressure on the new engine.• Follow TOPIX steps of diagnosis	

