

Latest Vehicle Concern Fixes



Gearbox overheat	18MY Onwards RR Evoque, Discovery Sport
<p>Customer Voice:</p> <ul style="list-style-type: none">The Gearbox Overheating message appeared in the instrument cluster. <p>Technical Description:</p> <ul style="list-style-type: none">Transmission oil temperatures rise above 220 degrees.P0218-98 may be present in the TCM. <p>Status:</p> <ul style="list-style-type: none">Perform extended road test in stop and go traffic and allow the vehicle to idle for an extended time while monitoring the transmission oil temperature.Verify the proper coolant hose routing is present. Monitor the cooler circuits (cooler inlet and outlet and coolant circuits) with an infrared camera to assist in identifying the root cause.Raise a TA if diagnostic support is required including the thermal images of the circuit.Raise an EPQR if repairs are performed and hold parts for return.	

