



# Service Bulletin

Bulletin No.: 19-NA-005

Date: August, 2019

## TECHNICAL

**Subject:** Hoot or Whistle Noise Heard at Highway Speeds

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Silverado 1500 (New Model)	2019	2019			L84, L87	
GMC	Sierra 1500 (New Model)						

<b>Involved Region or Country</b>	North America, Middle East, Chile, Uruguay and Thailand (ASEAN).
<b>Condition</b>	Some customers may comment that a hoot or whistle noise can be heard while driving at highway speeds around 70-74 MPH (113-119 km/h). Some technicians may find this noise is emitted during the canister purge cycle.
<b>Cause</b>	This condition may be caused by the inner surface of the vent line attached at the fill pipe, which has a convolute surface and may allow a whistle noise to occur during purge flow at higher flow rates.
<b>Correction</b>	If the noise was validated to be coming from the vent, replace the Fuel Tank Filler Pipe. ⇒ The fill neck has a revised vent line attached that has a smooth interior surface designed to eliminate vent whistle.

### Service Procedure

Refer to Fuel Tank Filler Pipe Replacement in SI.

### Parts Information

Causal Part	Description	Part Number	Qty
X	PIPE, F/TNK FIL (W/FIL HOSE)	84626473	1

## Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4028270	Fuel Tank Filler Pipe Replacement	Use the Published Labor Operations Time

Version	2
Modified	Released January 10, 2019 Revised July 31, 2019 - Update part number.

