



Service Bulletin


Bulletin No.: 19-NA-025


Date: July, 2019

TECHNICAL

Subject: Front Turn Signal Lamp Flashing Fast, or Inoperative

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	XT4	2019	2019	SOP	Prior to November 15, 2018	All	All


Involved Region or Country	North America, Middle East, Israel
Additional Options (RPOs)	EXC - LED LAMP FRT TURN SIGNAL (UGC)
Condition	<div></div> <p>5233431</p> <p>Some customers may comment on a front turn signal flashing fast or inoperative.</p>
Cause	The cause of the condition may be that the original lamp socket body was molded with a void under the terminal pins (1). This space would sometimes allow the terminal to move, resulting in an intermittent or complete loss of contact to the ring inside the lamp.

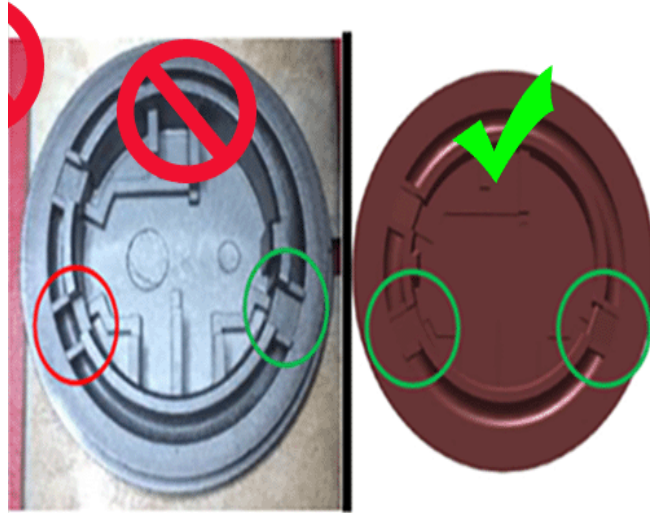

5233432

Note: A design change was made to the socket mold to fill in the void area. The graphic above shows the void filled in to eliminate terminal movement and correct the condition.

Correction

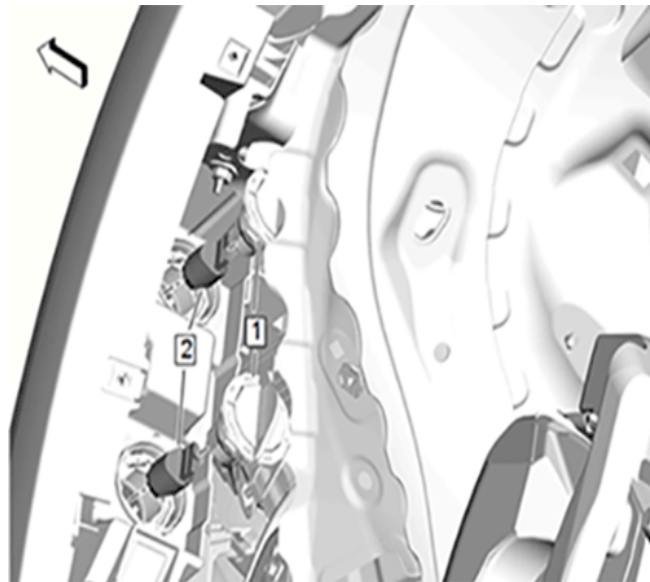

5233433

For vehicles built prior to the breakpoint noted above, replace the sockets (1) on the affected side (Qty 2) and inspect the bulbs (2) to determine if the bulb is actually burnt out. Replace bulb only as necessary.

Refer to the appropriate side *Headlamp Bulb Replacement* in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	SOCKET-FRT SI T/SIG LP	84233265	2

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2044340	Exterior Lamp Bulb Socket Replacement	Use Published Labor Operation Time

Version	2
Modified	Released February 12, 2019 July 16, 2019 – Updated Involved Regions or Country and added EXC – RPO UGC to Additional Options (RPOs).

