

Stowage compartment in center console only opens on one side or not at all

Topic number	LI68.20-P-070037
Version	1
Function group	68.20 Center console
Date	07-11-2019
Validity	BR167
Reason for change	
Reason for block	

Complaint:

Stowage compartment in center console only opens on one side or not at all

Cause:

Possible causes:

Cause 1: The spring may have slipped off the correct position.

Cause 2: The hook on which the pop-up spring is hooked into may be broken.

Remedy:

Remedy 1. Slide spring on, if it has slipped off the axle.

Remedy 2. Hook spring into first of the three hooks (see picture in attachment), as this hook is designed to be the most stable. Both halves of the storage compartment cover should always be used for hooking in. This measure can increase the opening period for the stowage compartment.

Do not replace the component parts, as optimized components will become available. Please use this rework solution as a temporary measure, until the optimized component parts are available. As soon as optimized parts are available, this LI will be updated.

Attachments	
File	Description
Hook.JPG	Attach spring at hook number 1

Symptoms
Body / Interior equipment / Stowage box/tray / Warped/twisted/distorted
Body / Interior equipment / Stowage box/tray / Broken

Operation numbers/damage codes

XENTRY TIPS

Op. no.	Operation text	Time	Damage code	Note
68-6054	REPLACE STOWAGE COMPARTMENT IN ARM REST 68-6054-01	11	68119 06	Rework the armrest as an interim solution and do not replace it (until improved parts are available).
68-6054	REPLACE STOWAGE COMPARTMENT IN ARM REST 68-6054-01	11	68119 D6	Rework the armrest as an interim solution and do not replace it (until improved parts are available).

WIS-References			
Document number	Title	Note	Allocation
AR68.20-P-2370ME	Remove/install arm rest cover on center console		Remedy

Attachments

Hook.JPG:

