



## Preliminary Information

### PIP5522C 6.0L Engine Noise and/or Misfire

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Express	2017 - 2018	All	All	6.0L L96 LC8	All
Chevrolet	LCF	2017 - 2018	All	All	6.0L L96 LC8	All
Chevrolet	Silverado HD	2017 - 2018	All	All	6.0L L96 LC8	All
GMC	Savana	2017 - 2018	All	All	6.0L L96 LC8	All
GMC	Sierra HD	2017 - 2018	All	All	6.0L L96 LC8	All

Involved Region or Country	North America
Additional Options (RPO)	L96 LC8
Condition	A vehicle may have a concern of engine noise and/or a misfire
Cause	This may be caused by a broken rocker arm

#### Correction:

Inspect for possible broken rocker arms that could result in the valve dropping to the cylinder, causing a catastrophic failure and the engine requires replacement due to cylinder head and block damage.

If a broken rocker arm is found check to see if the valve dropped into the cylinder if so the engine will need to be replaced.

On occasions the valve will not drop into the cylinders, reinstall any valve keepers that may have been dislodged and replace all 8 of the intake rocker arms.

#### Warranty Information

Labor Operation	Description	Labor Time
4081908	For tracking uses, use published labor times	3.0 Hr
*This is a unique Labor Operation for Bulletin use only.		

#### Additional SI Keywords

arm, rocker. rocker-arm, rockerarms,

#### Version History

Version	
Modified	9/21/2017 - Created 9/27/17 - Added 2018 Model Year 12/19/17 - Edited labor op 08/16/2019 - Clarify work instructions



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.