



Preliminary Information

PIT5675B Diagnostic Tip: Loss of Power Steering Assist May Have Chassis Bus Communication Codes or C0800 in The PSCM

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2020	All	All	All	All
GMC	Terrain	2018 - 2020	All	All	All	All

Involved Region or Country:	North America
Condition:	Loss Of Power Steering Assist May Have Chassis Bus Communication Codes Or C0800 In The PSCM.
Cause:	Inspect G112 for a standard nut versus a shouldered nut similar to the one shown below. If the standard nut is installed it will not provide proper clamp load on the ground lug.



Engineering is reviewing this concern with the assembly plant. This may become a bulletin as more information becomes available.

Version History

Version	3
Created	04/18/2019 - Created on. 04/30/2019 - Updated to add picture. 08/22/2019 - Added 2020 model Year

