

Special Service Message

NOTE: A Special Service Message is a formal communication issued by Jaguar and carries the same importance of a Technical Service Bulletin. An SSM is a quick method of communicating "Need To Know" information to the technical service community. SSM's may be issued in advance of a technical bulletin or may be the only communication on a given topic. All information contained in Jaguar technical communications are intended for use by trained, professional technicians with the knowledge, tools, and equipment required to complete the procedure correctly and safely. It informs the Technicians of conditions that may occur on some vehicles, or provides information that could assist in correct vehicle and diagnostic service.

SSM 74504 - 17MY AJ20-D4 X761 F-PACE MIL Illuminated with DTC
P0521- 84 and/or P0521-85

Models : F-Pace / X761

Engineer McArthur Elyse

Name :

Last 02 AUG 2019 13:47:54

Modified :

Category : Engine

Symptom : 401000 Oil System Concerns

Content : Issue: Engine Malfunction Indicator Lamp (MIL)
Illuminated

Cause: P0521-84 and/or P0521-85 is stored in the PCM
for Engine Oil Pressure Sensor/ Switch "A"
Range/Performance.

Action: Please follow TOPIx for guidance.

- Check & Correct oil level if required
- Check the oil level & temperature sensor circuit for short to ground, power, open circuit & high resistance
- Inspect connectors for signs of water ingress and pins for damage and/or corrosion

Should no root cause be found, verify the production date. Only if the vehicle has a production date between 19-September- 2016 and 26-September-2016, replace the oil pump. If the vehicle is outside of the aforementioned production dates, raise a TA prior to any parts replacements. Provide all primary & secondary diagnosis data in the TA, as well as a current session file.